

Flight Evaluation of the Communications Earplug in the OH-58D Helicopter

Part 2. Questionnaire Data

By

Barbara A. Murphy and Ben T. Mozo

Aircrew Protection Division

October 1999

DTIC QUALITY INSPECTED 4

19991209 059

Approved for public release, distribution unlimited.

U.S. Army Aeromedical Research Laboratory Fort Rucker, Alabama 36362-0577

Notice

Qualified requesters

Qualified requesters may obtain copies from the Defense Technical Information Center (DTIC), Cameron Station, Alexandria, Virginia 22314. Orders will be expedited if placed through the librarian or other person designated to request documents from DTIC.

Change of address

Organizations receiving reports from the U.S. Army Aeromedical Research Laboratory on automatic mailing lists should confirm correct address when corresponding about laboratory reports.

Disposition

Destroy this document when it is no longer needed. Do not return it to the originator.

Disclaimer

The views, opinions, and/or findings contained in this report are those of the author(s) and should not be construed as an official Department of the Army position, policy, or decision, unless so designated by other official documentation. Citation of trade names in this report does not constitute an official Department of the Army endorsement or approval of the use of such commercial items.

Human use

Human subjects participated in these studies after giving their free and informed voluntary consent. Investigators adhered to AR 70-25 and USAMRMC Reg 70-25 on Use of Volunteers in Research.

REPORT	DOCUMENTATI	ON PAGE			n Approved 3 No. 0704-0188
1a. REPORT SECURITY CLASSIFICATION Unclassified		1b. RESTRICTIV	E MARKINGS		
2a. SECURITY CLASSIFICATION AUTHORITY		3. DISTRIBUTION Approved	N/AVAILABILITY OF REPO for public rel	ORT Lease, di	stribution
2b. DECLASSIFICATION / DOWNGRADING SCHEDU	LE	unlimited			
4. PERFORMING ORGANIZATION REPORT NUMBER USAARL Report No. 2000-05	R(S)	5. MONITORING	ORGANIZATION REPORT	NUMBER(S)	
6a. NAME OF PERFORMING ORGANIZATION U.S. Army Aeromedical Research Laboratory	6b. OFFICE SYMBOL (If applicable) MCMR-UAD	U.S. Army	ONITORING ORGANIZATION Y Medical Resea Command (USAME	arch and	
6c. ADDRESS (City, State, and ZIP Code) P.O. Box 620577 Fort Rucker, AL 36362-0577	•	504 Scott	Dity, State, and ZIP Code) t Street, rick, MD 21702-	-5012	
8a. NAME OF FUNDING/SPONSORING ORGANIZATION US Army Medical Rsch Acq Act	8b. OFFICE SYMBOL (If applicable) MCMR-AAA-A	9. PROCUREME	NT INSTRUMENT IDENTIF	FICATION NUME	BER
8c. ADDRESS (City, State, and ZIP Code)	-	10. SOURCE OF	FUNDING NUMBERS		
829 Chandler Street Fort Detrick, MD 21702-5009		PROGRAM ELEMENT NO.	PROJECT NO.	TASK NO.	WORK UNIT ACCESSION NO.
		63787A	3016287A878	OF	DA360347
11. TITLE (Include Security Classification) Flight Evaluation of the Com Part 2: Questionnaire Data 12. PERSONAL AUTHOR(S) Barbara A. Murphy and Ben T	(U)	ug in the C	OH-58D Helicopt	er,	
	E COVERED TO	14. DATE OF RE 1999 Oc	PORT <i>(Year, Month, Day)</i> tober	15. PAGE (
16. SUPPLEMENTAL NOTATION					
17. COSATI CODES	18. SUBJECT TERMS (C	ontinue on reverse if	necessary and identify by b	lock number)	
FIELD GROUP SUB-GROUP	7				
19. ABSTRACT (Continue on reverse if necessary and Aviators assigned to OH-58D assessment of the communicat that is readily available fo Integrated Systems (PM-ACIS) assigned to OH-58D operation	helicopter operat ions earplug (CEP r immediate field purchased enough). The CEF ing. Durin CEPs to ou	o is a low cost ng FY97, Projec ntfit all aviat	and sime t Manage ors curr	ple approach r-Aircrew ently
sample of users for evaluati solving hearing protection a performs well during daily minadequate speech clarity an this report, published separ study. Part 2, the present individual subject responses	ng the effectiven nd communication issions and is co d understanding i ately, presents t report, contains	ess of the problems in nsidered a n the Kiowa he method a the dataset	current CEP con the OH-58D he viable solution Warrior helicund assessment to allow clos	nfigurat licopter n to the opter. findings e inspec	ion in . The CEP problem of Part 1 of of the
20. DISTRIBUTION / AVAILABILITY OF ABSTRACT UNCLASSIFIED/UNLIMITED SAME AS	RPT. DTIC USERS	21. ABSTRACT S Unclassif	SECURITY CLASSIFICATION Fied		
22a. NAME OF RESPONSIBLE INDIVIDUAL Chief, Science Support Cente	r	22b. TELEPHONE (334) 255	(Include Area Code) 5–6907	22c. OFFICES MCMR-UA	
DD Form 1472 IUN 96	Previous editions are	obsolete	SECURIT	V CLASSIFICAT	ION OF THIS PAGE

Preface

This work was funded by the Project Manager-Aircrew Integrated Systems (PM-ACIS). The authors would like to thank all the individuals involved in the installation of the Communications Earplug into the HGU-56/P helmets.

Table of contents

	Page
Background to questionnaire dataset	1
Questionnaire responses	2
Questions 1 thru 8	2
Questions 9 thru 13	
Questions 14 thru 17	
Questions 18 thru 24	
Questions 25 thru 29	
Questions 30 thru 33	
Questions 34 thru 41	59
Questions 42 thru 43	66
Questions 44 thru 45	74
Reference	92
Appendix	93
List of figures	
Figure 1. CEP integrated into HGU-56/P aviator helmet	1

Background to the questionnaire data set

During FY 97, the Project Manager, Aircrew Integrated Systems (PM-ACIS) purchased enough Communications Earplugs (CEPs) to outfit all aviators currently assigned to OH-58D operational units. The CEPs were installed in HGU-56/P aviator helmets under the direction of PM-ACIS, with assistance provided by the U.S. Army Aeromedical Research Laboratory (USAARL). The acceptability of the CEP was assessed by asking aviators to compare the CEP helmet combination (Figure 1) with the helmet systems currently used in the OH-58D helicopter.

A novel questionnaire was constructed for this study (Appendix). The questionnaire consists of eight general sections: personal data, personal hearing protection, fitting, comfort, donning and doffing, speech clarity/understanding, noise reduction/attenuation, and general issues.

Part 1 of this report contains the details of the methods, analysis, and results of this survey research (Murphy and Mozo, 1999). This publication, Part 2, contains the data tables necessary to allow close inspection of individual subject responses

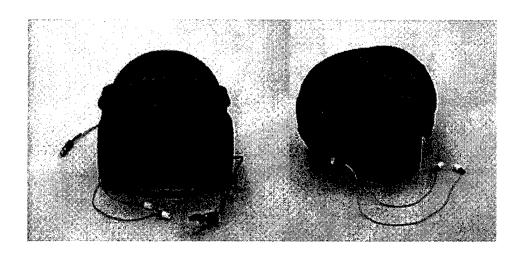


Figure 1. CEP integrated into HGU-56/P aviator helmet.

	80	Seat	DOSIGION	Right	Right	Right	Right	Both		Left and right	Left	Left	Right		Left and right	Left and right	Right and left equal	Right	Left	Both	Fixed	Both	Right/pilot
ter	07	Tip	2776	short	std	std	std	short	std	short	std	std	std	std	Combo	std	std	short	short	slim	std	std	std
Evaluation in the OH-58D Helicopter	Q6a	CEP still functioning		_	1	0 Plastic post attached to left ear piece snapped off	1	1			1	-	 Screw-tip portion broke off on right ear plug 	-	-			1	1	0 Because it broke at ear cushion connection	0 Right carplug broke off from cable	_	0 One of the troops crew chiefs thought they were just earplugs then just lost them
the OH	90	Flight hours	TO Suren				20	100	200		09	250	∞	150	200	200	125		125	25	250	100	S
ation in	65	Flight hours	SC COLL GIRE	300	120	009	300	50	400	300	99		100	350	300	240	225	150	150	20	200	120	969
Evalu		<u>xperience</u>	Pin Circ	1000	420	2200	1700	009	009	1000	200	200		200	1500	440	550	009	1500	1500	640	. 365	700
light I	40	Aviator E	1	7	3	10	9	3	3	4	7	2		4	∞	2	3	4	11	7	e	7	4
EP Fligh	63	Gender		×	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ
C	01			-	7	က	4	2	9	7	∞	6	10	11	12	13	14	15	16	11	18	61	20
	QI	Unit location		;																			

¹ For the Yes/No questions, "Yes"=1 and "No"=0

·	Seat position	Left and right	≝ .	c		ht	ht	Standard	Split duties right and left.		þt	Left or right	¥	£	ىد		سد		£	ħ	,ht	;ht
80	Seat posit	Leff	ıığır.	Both		Right	Right	Star	Spli	RVL	Right	Lef	Right	Both	Left	Left	Left	Left	Both	Right	Right	Right
Q7	Tip size	std	n :	std	std	std	std	std	std	short	std	std	std	std	std	stq	std	std	std	std	stq	std
Q6a	CEP still functioning		nd pr	-	 Left earplug separated at earplug housing from wire during NBC flight. 	,		_	_		1	1	1	1	-	0 My original pair broke. I'm on my third pair.	0 Wire broke	1	O Ear portion and cord became separated when caught up in the survival vest during	0 Screw tip broke off	0 Left wire into speaker is loose and sound comes in and out	0 Intermittent operation on right side
90	Flight hours using CEP	110	ć	07	200		150			250	200	100		300	80	300	300	250	100	20		
05	Flight hours using HGU-56	50	001	001		300	400	120	400	300	200	400	100	100	120		300		70	400	25	225
	r Experience Flight Hours	200	360	930	430	750	530	200	006	006	1000		200	850	820	1200	2000	200	750	059	750	400
04	Aviator E. Years Flig	2	י ר	n	~ .	4	4	3	\$	5	9	4	ю	4	7	9	10	2	S	4	S	2
<u>0</u> 3	Gender	ΣX	Ε >	M	Σ	Σ	Σ	Σ	Σ	í.	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ	Σ
Q1	Num Mum	21	7 6	57	-	7	3	4	8	9	7	∞	6	10	=	12	13	14	115	16	17	81
01	Unit location	1.																				

Q1 Unit location	Q1 Num	Q3 Gender	Q4 Aviator E Years Fli	Experience ight Hours	Q5 Flight hours using HGU-56	Q6 Flight hours using CEP	Qба CEP still functioning	Q7. Tip size	Q8 Seat position
2.	19	M	3	550	7.5		0 Wires broke away from ear piece	std	
·	70	Σ	8	700	230	180		Combo	Right/left equal
. .	_	ഥ	2	400	150	-	-	std	Left
	7	M	9	2300	150	100	1 After one repair of broken stem	std	R/L
	3	Σ	10	1600	400	300	1	std	Right
	4	Σ	4	200	150			slim	Left
	S	Σ	S	008	109		-	std	Right
	9	Σ	9	1200	200	200	1	slim	Right
	7	Σ	ς	006	100	200	-	short	Right
	∞ .	Σ	4	1200	70		O The foam earplugs broke off after first use. ALSE repaired and it took about 5 more flight hours before they broke again	std	Right/left
	6	Σ	01	1500	200	200	-	std	Right
	10	M	2	200	20	250		std	Right/Left
	Ξ	X	2	200	100	200	1	std	Right
	12	Σ	9	1250	250	15	-	std	N/A
	13	Σ	13	3300	400		0 Wire broke on one side where wire connects to plug itself.	std	Right
	14	Σ	2	650	200			std	Both left and right0
	15	Σ	10		30	9		std	Upright
	91	Σ	10	2100	70	Ś	1	std	Right
	17	×	ю	450	0	0	 Bong and whistles are too damned loud 	std	Right
4.	•	;		ò				,	·
		Σ	4	800				std	Right
	2	Σ	2	430	150	50	-	std	Upright

														put					±			eats.			
Q8 Seat position			Right	Left seat	Both	Right seat	Yes	Left		Left	Right	Left	Left	Equally left and right		Left	Left/right	Both	Left and right equally	Right	Left	Equal both seats.	Right	Right	ı
Q7 Tip size		std	slim	short	slim		std	std		short	std	std	std		std	std	std	std	std	short	slim	std		std	
Q6a CEP still functioning		-	-	-	_	-	1	1			-	-	_		_	-	1	_	-		0 Left earplug intermittent, possibly due to wire breaking. ALSE issued me a new CEP.	-	-	1	
Q6 Flight hours using CEP						70	40				200		10	10			100	30	20		125	9	2	10	
Q5 Flight hours using HGU-56		40	200	20	100		09	20		6		250	240	20	15.	100	01		20	9	40	40	120	20	
Aviator Experience Cears Flight Hours		1200	1100	550	029	1600	1000	300		499	1000	2300	250	400	670	800	400	2000	400	400	2500	290	400	200	0
Q4 Aviator E Years Fli		4	S	4	4	6	S	2		-	S	6	-	7	\$	S	3	17	2	3	6	4	7	3	
Q3 Gender		Σ	Σ	Σ	Σ	Σ	Σ	Σ		×	Σ	Σ		Σ	Σ	Σ	Σ	Σ	Σ	Σ		Σ	Σ	Σ	7
Q1 ID Num		33	4	5	9	7	∞	6		-	7	٣	4	S	9	7	∞	6	10	11	12	13	14	15	`.
Q1 Unit location	4.								5.																

Q1 Unit location	Q1 UD Num	Q3 Gender	Q4 Aviator E Years Fli	4 Aviator Experience ears Flight Hours	Q5 Flight hours using HGU-56	Q6 Flight hours using CEP	Qба CEP still functioning	Q7 Tip size	Q8 Seat position
6.									
		Σ	9	1100	200	300	1 None	std	N/A
	7	Σ	6	2200	400	200	1 None	short	Right
	m	Σ	2	200	50		1	std	Left
	4	Σ	∞	725	275	125		slim	Left
	2	Σ	9	750			 Earplug broke off at tip. 	short	Left and right
	9	Σ	13	3100	150	150	-	std	Left
	7	Σ		1000	100		1	std	Both
	∞	Σ	9	1400		100	-	std	Left and right
	6	Σ	9	1200	200		-	std	Left and right
	10	Σ	10	2100	009	4	1		Right
7.									
	1	Ľ	4	200	100	50		slim	Left/right
	7	Σ	S	1115			1	std	Left
	ю	Σ	e	400	S	110	_	short	Right
	4	Σ	2	470	100		-	short	Both equally
	'n	Σ	15	4000	200	200	_	slim	OH-58D(I) has one seat position
	9	Σ	9	1000	800	200	-	slim	Left and right
	7	Σ	10	1700	200		-	std	Either
	∞	Σ	4	550	150		-	std	Both
	6	Σ	9	1400	200	150	0 Wires broke	slim	Left
	10	Σ	7	1350	20		-	std	Left
	=	×	4	006	100	200	0 Broken wire, broken earplug tip	tip std	Left/right
	12	Σ	2	400	200		0 Broken wire and earplug tip.	std	Left/right
	13	Σ	∞	2700	300	. 250	_	std	Either of the two front seats
	14	Σ	∞	1200	150		-	std	OH-58D(I) the only position

	1																							•	
Q8 Seat position	right	Both	Both		Left	Left/right	Equal	Right	Left		Left and right	Left	Equally left and right	Pilot or copilot	Left		Seat does not move	Both pilot and copilot	Left seat	Equal	Left	Left and right	Both	Right and left	Left
Q7 Tip size	std	short	std	std	std	std	std	std	std		slim	std	short		std		std	short	std		std	std	slim	short	std
Q6a CEP still functioning	0 Wire keeps breaking from the foam earplug.	-		-	1	1	1		1		1	1	-	1	1			1	***	1	1		1 Twice broken/ shorted wire		1
Q6 Flight hours using CEP		150			200	200	100	150			250	400	200	90				250	20	20	200	200		20	20
Q5 Flight hours using HGU-56	200	200		400	150	-	50	200	12					300	9		2300								
Experience light Hours	009	006	1200	550	850	1400	3200	1200	006		10500	2400	2200	4500	2700		2700	4000	4500	1800	2500	4500	1000	- 0009	5400
Q4 <u>Aviator E3</u> Years Flig	2	9	9	4	∞	∞	15	9	9		30	8	10	14	10	81	6	91	16	7	∞	15	9	11	91
Q3 Gender	Σ	Σ	X	Σ	Σ	Σ	Σ	Σ	Σ		Σ	Σ	Σ	Σ	Σ	Σ		Σ	×	Σ	Σ	Σ	Σ	Σ	Σ
Q1 ID Num	15	16	17	18	19	20	21	22	23		_	7	3	4	S	9	7	∞	6	10	11	12	13	14	15
Q1 Unit location	7.									∞:															

Q1		63	04		05	90	Q6a	07	80
Unit location	E	Gender	<u>Aviatc</u> Years	Aviator Experience (ears Flight Hours	Flight hours using HGU-56	Flight hours using CEP	CEP still functioning	Tip size	Seat position
8.									
	91	Σ	5	1600	1300	300		slim	Left
	17	Σ	9	1700	250	20		std	Left and right
9.)
	-	Σ	3	200	20		1	slim	L/R
	7	Σ	7	1200	100	150	.	std	Right seat
	3	Σ	61	3400	25	200	0 Dead right plug	std	Left
	4	Σ	3	200	200	300	1	slim	Both
	2	×	4	009	250	150	1	std	Right
	9	Σ	3	570		70	1	std	Both
	7	Σ	15	4100	2	400	. -	std	Both
	∞	Σ	9	1000	100	. 20	-	short	Left
	6	Σ	3	350	10	4	1	std	Left
	10	Σ	12	3000	100	20	1	std	Both
	=	×	=	1800		10	1	std	Right
	12	Σ	15	1300	15	01	1	std	Fixed
	13	Σ	2	200	150	50	1	short	Even split L/R
	14	Σ	4	800	20	150	1	short	Right
	15	Σ	4	009	01	10	1	slim	Left
	16	Σ	3	200			1	short	
10.									
	1	Σ	5	750		150	1	std	Right and left
0	Overall Total	M = 146 $F = 3$ $NR = 3$	Sum 963.5 Avg 6.4	199414.0	Avg 205.3	Avg 129.4	Yes = 126 N = 23 NR = 3		
		7CI = N					•		

Q1 Unit location ID	Q1 DVum	Q9 Waiver or IO letter	Q10 Fly with spectacle	Spectacle type	Q11 Wear earplugs with helmet	Q12 Discomfort w/earplugs - onset and description	- sg	Q13 Discomfort w/ Pand description	Q13 Discomfort w/ helmet - onset and description
1.									
	-	0	0		***	1	Lack of ICS volume	0	
	7	0	0		****	1 2-3 hours, combined w/ hearing difficulty	Pain	1 3-4 hours	rs Hot spots, headaches
	3	0	0		1	0		0	
	4	0	0		1	0		0	
	\$	0	0		1	0		0	
	9		0		0			0	
	7	0	0		1	0		0	
	•	0	1	Bayonet	1	0		0	
	6	0	0		-	0		0	
	10	0	0		1	0		0	
	Ξ	0	0			 Only until I break them Slight pain in 	em Slight pain	0	
	12	0	0		-	0		0	
	13	0	0		-	0		0	
	14	0	0		1	0		0	
	15	0	0		0		Pain in the ear can	0	
	16	0	0		0			0	
	11	0	0		0	1 Few hours	dull pain, continuous after a few days flying	0	
	81	0	o		-	0		1 30 minutes	discomfort from the size of the speaker, other times it felt as though the plastic portion of the plug was contacting my ear canal.
	16	0	0		1	. 0		0	
	70	0	0		1	1 2 hours	Itching, sweating 0	0 5	

Q1 Q1 Unit location ID	9.01 Num Num	Q9 Waiver or IO letter	Q10 Fly with spectacle	Spectacle type	Q11 Wear earplugs with helmet	Q12 Discomfort w/earplugs - onset and description		Q13 Discomfort w/ helmet - onset and description
	7	•	•					
	7 6	-	.		_ ,	0 .•		0
	77	>	>		_	0		0
	23	0	0		1	0		0
2.								
	-	0	1	Wire frames	_	0		0
	2	0	0		_	1	Itchiness	· c
	3	0	0			0		. 0
	4	0	0		0			
	2	0	0		0	0		
	9	0	0		-	1 3-4 hours	Itchiness, pain	
	7	0	0	Sunglasses	1		_	0
				during the day	,			
	.∞	0	-	Cable		0		0
	6	0	0			0		0
	01	0	0			0		1 2.5-3.0 hrs Hot spot
								under NVG
	11	0	0			0		1 I hour Hot snots
	12	0	0			0		
	13	0	0		0			0
	14	0	0			0		
	15	0	0		1	1 2-3 hours /	Aching in inner	1 2-3 hours Hot spot on top of head.
						•	ear	
	16	0	0		1	0		
	17	0	0		-	0		1 45 minutes Hot snots
	18	0	0			0		0

Q1 Q1 Unit location ID	Q1 ID Num	Q9 Waiver or IO letter	Q10 Fly with spectacle	Spectacle type	Q11 Wear earplugs with helmet	Q12 Discomfort w/earplugs - onset and description	uc - sān	Q13 Disco and d	Q13 Discomfort w/ hor and description	Q13 Discomfort w/ helmet - onset and description
2.	61	0	0		1	0		-	ing	Pain inside ear opening
	70	0	0			,		-	to end	Hot enot ton of my head
	1	,	•			•		•	with NVGs, 3-4 hours w/o NVGs	not spot top of his nead
3.										
	-	0	0		1	1 30 minutes	itch	_	30 minutes hotspots	hotspots
	7	0	-	Bayonet	1	0		0		•
	ю	0	0		1	0		0		
	4	0	0		-	1		0		
	S	0	0			0		0		
	9	0	0		_	0		0		
	7	0	0		-	0		-	2 hours	hotspots usually associated with NVGs
	∞	0	0		1	0		0		
	6	0	0		-	0		0		
	10	0	0		-	0		0		
	11	0	0		-	0		_	2 hours	hotspot
	12	0	0		0			0		
	13	0	0		-	0		0		
	14	0	0		-	0		0		
	15	0	0		-	0		0		
	91	0	-		1	0		0		
•	11	0	0		1	0		0.		
÷	—	0	0			1 15-20 minutes if not immediately.	The plastic core presses into the car when the cup	0		
							is praced over it			

							j		
Q1 Unit location	S ⊟ S m Num	Q9 Waiver or IO letter	Q10 Fly with spectacle	Spectacle type	Q11 Wear earplugs with helmet	Q12 Discomfort w/earplugs - onset and description	: S2	Q13 Discomfort w/ helmet - onset and description	elmet - onset
4.								mondings and	
:	7	0	0		1	1 Varies	Itchiness,	0	
				•			uncomfortable, slipping		
	33	0	0					0	
	4	0	0		-	0		· c	
	'n	0	-	Bayonet temples, wire frames.	_	1 About 3 hours	Pain in upper car. 0	· 0	
	9	0	0		-	1 Varies from 15 minutes Itchiness with a to 1 hour.	es Itchiness with a	1 15 minutes	15 minutes Hot spot on forehead.
	7	1 l year	0		0			c	
	∞	0	0		1	-	Itchinese nain	1 hour	Ust snote beadeate
	6	0	0		_	0	, con	1 Soon	Hot snots
5.									store about
	-	0	0		-	. 0		0	
	7	0	0			0		. 0	
	e	0	0		0	0			Headaches (noise
	4	0	0		1	0		. 0	Tradactics (HOISE
	S	0	0			0			30 minutes Hot snot on ton of helmet
	9	0	0		1	0			
	_	0	0		1	1 As soon as I put them in.	Pain - the foam earplugs when screwed in - the screwed in part stabs my ear so I can't place the foam part as far in as I like too.	0	
	∞	0	0		0	0		1 1 hour	Hot spots on forehead, headaches
	6	_	0		panel.	1 After a couple of adjustments I could fix	Pain		

Q13 Discomfort w/ helmet - onset and description					Hot spots	•						Head itches.												30 minutes hot spots	•		
Q13 Discomfort w/ P					3 hours							2 hours												30 minutes			
Q13 Disco				0	_	0	0	0		0	0	 	0	0	0	0	0	0	0		0	0	0	-	0		0
arplugs - ption				Itchiness								Dull pain. Some itchiness.															
Q12 Discomfort w/earplugs - onset and description		0	0	-			0	0				+1	0	0	0	0	0	0	0			0	0	0			0
Q11 Wear earplugs with helmet		1	-	1	-	0	1	_		0	0	-	-	_		1	1	1	1		0	1		1	0		
Spectacle type											Strap														Comfort	cables (wrap around)	
Q10 Fly with spectacle		0	0	0	0	0	0	0		0	_	0	0	_	0	. 0	0	0	0		0	0	0	0	_		0
Q9 Waiver or IO letter		0	0	0	0	0	0	0		0	0	0	0	0	0	0	0	0	0		0	0	0	0	0		0
Q1 ID Num		10	11	12	13	14	15	16		-	7	3	4	8	9	7	∞	6	10		-	7	ю	4	S		9
Q1 Unit location	5.								9									, .		7.							

	5 :	ව		Q10		Q11	Q12		Q13		
Unit location ID	O M	Wa 101	Waiver or IO letter	Fly with spectacle	Spectacle type	Wear earplugs with helmet	Discomfort w/earplugs - onset and description	- S2	Discomfort w/ I and description	t w/ he	Discomfort w/ helmet - onset and description
7.											
	7		In process	-	Bayonet	1	0		1 After 1.5		Hot spot
	•	•		,					hour	s	
	>	>		0		0	0		0		
	6	0		0		1	0		0		
	10	0		0		0	.0		0		
	=======================================	0		0		0			0		
	12	0		0		-	0		. 0		
	13	0		0		-	0		Ö		
	14	0		_	Wire	1	0		. 0		
	15	0		0		0					
	16	0		0		-	0				
	17	0		. 0		0	1 2 hours	Itching	1 1 hour	=	
	18	0		1		0)		ı	
	19	0		0		_	0		0		
	70	0		_	Wire frame	1	. 0		0		
					Ray-Ban sunglasses						
	77	0		0		1	0		0		
	22	0		0		-	. 0		1 1/2 hour		Hot spots and headache.
											helmet. Too big and bulky.
ć	23	0		0		1	0		1 1 minute		Could not hear!
ó	1	-	16 years	_	Bayonet temples	1	0		0		
	7	0		0		-	0		0		
	က	0		0		_	0		· 0		
	4	0		0		1	1 Within 45 minutes	Poking pain	0		

onset					Hot spot top center of forehead	i															ts	
elmet -					Hot spot																Hot spots	ı
Q13 Discomfort w/ helmet - onset and description			I did after I tried to use it.		1 hour																1 hour	
Q13 Disc	٠	• •	0	0	-	0	0	0	0	0	nal. 0	0	0	•	• •	0	0	0	0	0	-	0
gs -	П го го								pain		Pain in ear canal. Full feeling in my head.											
Q12 Discomfort w/earplugs - onset and description	1 About 30 minutes		0	0	0	0	0	0	1 2-3 hours	0	1 5-10 minutes	0	0	c	0	0	0	0	0	0	0	0
Q11 Wear earplugs with helmet	-		0	1	1	1	0		1	-	0	-	1	_	-	1	1	1	1	-	1	
Spectacle type												,	Wire frames				Wrap around					
Q10 Fly with spectacle	o	0	0	0	0	0	0	0	0	0	0	0	1	c	0	0	_	0	0	0	0	0
Q9 Waiver or IO letter							2 years									8 years						
E .	5 0	9	7 0	°	0 6	10 0	11 1	12 0	13 0	14 0	15 0	16 0	17 0	0	2 0	3 1	4 0	5 0	0 9	7 0	8	0 6
on ID																						
Q1 Unit location	∞													٠ <u>.</u>								

Q1 Unit location ID Nu	OI Num	Q9 Waiver or IO letter	Q10 Fly with spectacle	Spectacle type	Q11 Wear earplugs with helmet	Q12 Discomfort w/earplugs - onset and description	Q13 Discomfort w/ helmet - onset and description
9.							
	10	0	1	Wire frames	0	0	0
	11	0	0		0		· c
	12		0		_	1 Itching nain	1 45 minutes Hot enote
	13	0	0			0	O O
	14	0	0			0	
	15	0	0		-	0) C
	91	0	0		\$1.01	0	
10.							•
	-	0	0		1	0	0
Overall Total	N = 152	Yes = 7 N = 145 NR = 0	Yes = 17 N = 135 NR = 0		Yes = 121 N = 29 NR = 2	Yes = 26 N = 110 NR = 16	Yes = 27 N = 120 NR = 5

I nit location	ο O Mum		Q14 Difficulty in fitting CEP	Q15 Discomfort inserting CEP	Q16 Wire wher	Q16 Wires pull on CEP when turning head	Q17 CEP duri	Q17 CEP move in/out of ear during flight
		0		0	0		-	Occasionally slips out of ear
	7	0		0	0		-	Sometimes w/ excessive head movement
	es.	0		0	-	Small Velcro piece becomes detached, hangs free and sways.	-	Backs out of ear canal if not fully seated.
	4	0		0	-	Thy will get caught on anything from shoulder harnesses to flight suit collars	0	
	'n	-	After washing them they lose their ability to stay crimped during insertion.		0		0	
	9	-	After repeated use they are difficult to slide in ears - not impossible though.	0		Sometimes during NVG flights, the wires get tangled with the NVG neck cord, power cord or battery pack.	-	Occasionally they will fall out of ear during long flight
	7	0		1 The hard post rubs inside of ear.	-	If you make rapid head movements they tend to pull out.	-	After you start to sweat they come out of your ears.
	∞	-	Hard to get the CEP into the car and have it stay in place.	1 There is not as much cushion as with the yellow foam ear plugs.	-	The wires catch on the vest	-	When you sweat the CEP slips out of ear
	6	0		0	-	The wires sometimes become caught on misc. items.	-	They sometimes get pulled down by wire or when I adjust helmet.
	9	0		1 Housing creates a hard object which can press against the outer ear.			-	
	=	.0		0	••••	If not attached high enough on the helmet the CEP wire catches on the helmets lower edge	0	
	17	_	Earplugs too large initially	1 Plastic screw too long	0		0	
	13	0		_	-	About 50% of the time I feel the wire pull when turning my head	-	Occasionally
	4	0		0	0		0	
	15	0			-	The wires get caught in the seatbelt or the Velcro strip on the wire gets caught on something	-	from the wire pulling on the earplug during flight

Q1 Unit location ID	Q1 UD Num		Q14 Difficulty in fitting CEP	Q15 Discomfort inserting CEP	Q16 Wire	Q16 Wires pull on CEP when turning head	Q17 CEP move in/out of ear during flight
1.	16	-	Size adiustment Needed	C	ح		
			short	•	>		o o
	11	0		. 0		tangled around other wires	l tangled around other wires or
	18	0		0	_	They tend to catch under my collar	caugin on something
	19	0		1 Blunt sharp edges on the CEP hurts ear canal	-	They snag on helmet or on flight suit and usually pull out of ear	1 They work themselves loose on long flights
	70	0		0	-	With the neck cord from the NVGs it sometimes pulls on the CEP cords	1 Only if the helmet is moved
	21	-	Standard is too fat - slim is too slim	1 Plastic is hard - after 4-5 days of continuous use, ear canal is sensitive	0		0
	22	0		0	0		C
	23	0		0	0		. 0
2.							
	-	0		0	-	Sometimes the wires get tangled with either the NVG battery pack, ODA, or even the seat belt taking a lot of the slack out.	0
	7	0		0	0		1 Occasionally
	æ	0		0	-		
	4	0		0	-		0
	S	0		0	-	Gets caught on the back of the vest especially during NVG flight when the wire won't stay Velcro.	1 After about 2 hours, especially on warm days when your start sweating.
	9	0		0	0		. 0
	7	0		0		Only while wearing NVGs and weight bag	0
	∞	0		0	0		. 0
	6	0		0	0		0
	9	0		0	-	Occasionally, especially when wearing NVGs with the attached lanyard	0

Q1 Unit location ID Nu	Sum Sum		Q14 Difficulty in fitting CEP	Q15 Discor	Q15 Discomfort inserting CEP	Q16 Wires when	Q16 Wires pull on CEP when turning head	Q17 CEP durir	Q17 CEP move in/out of ear during flight
2.	=	0		0			We mount so much stuff on our head, the wires get intermixed	-	Once the foam inserts wear
	12	0		0	-	_	Sometimes it catches on the other lanyards and wire connections I.e. NVGs, ODA, ICS cable.	0	
	13	0		1 U	Until I get used to the feel of the plug			_	Because short wire pulled loose
	4	0		0		_	If I do not remember to keep the cord off my neck and over the survival vest it catches. A fix; create loop or Velcro hold to keep cord on helmet	-	If not inserted fully or hastily and the cord pulls - it comes out
	15	0		1 In In	In the beginning the edges might catch my I ear and after a while some mild aching inside the ear	_	Sometimes when caught on something. Mostly not.	_	Only infrequently did one slip out
	16	0		0	-		Sometimes when flying NVGs, while turning head CEP would get pulled out	0	
	11	0		0	1	_	Not often. If it catches on my shirt	_	It has. Installed in a hurry
	81		After wearing the CEP for more than 20 minutes the foam tip would not stay compressed for reinsertion back into the ear. Heat and moisture would prevent this	- i	Over time the foam tips would begin to litch		Wires would frequently catch on objects and pull out of the ear at times	-	At times the foam tip would back out of the ear canal
	19	-	Will not stay in ear	- S	Same as above	_	Wires are always in the way	_	At least slips out once on each flight
	20	-	Finding correct size foam insert and the diameter of the CEP itself	0	0	_		-	Occasionally
3.	_	c		•	•				
	- (5 (>		_		0	
	7	0		0	0	_		0	

			ب												
Q17 CEP move in/out of ear during flight	See #16	See #16	Sometimes when 'live fire" of weapons			See 16			Occasionally pulled out of place						When putting helmet on
8 0 9		1	-	0	0	-	0	0	-	-	0	0	0	0	-
Q16 Wires pull on CEP when turning	When Velcro catches on battery pack on helmet or other places such as vest	Well when turning head to left wires are pulled	Some times because of the limited space within the A/C	Only under NVG flying when I put the CEP in prior to putting on the NVG		They get hung up on other things attached to my helmet		Head turns more than 60 degrees left or right it often snags.	Occasionally pull plugs out of ear	Loose wire snags on things especially while wearing NVGs	Sometimes while turning head	If the wires are not positioned directly behind my head, the wires get tangled	Wires too long and catch on ICS cord and other items such as survival vest		
Q16 Wire CEP	-	_		-	0	_	0	-		_	_	-		_	-
Q15 Discomfort inserting CEP				The plastic housing hurt my earlobe during 1 the first few weeks. I repositioned by turning and now I can fly 4 hours or so without discomfort	Occasionally I fell the hard portion of inner core against eardrum when I insert in earcanal								The plastic center rubs the ear canal and is 1 very uncomfortable		
Q15 Disc	0	0	0		-	0	0	0	0	0	0	o ,	-	0	0
Q14 Difficulty in fitting CEP															When putting helmet on CEP would move and cause discomfort
	0	0	0	0	0	0	0	0	0	0	0	0 .	0	0	-
Q1 ID Num	8	4	S	9	7	∞	6	10	Ξ	12	13	4	15	16	17
Q1 Unit location	÷														

Q17 CEP move in/out of ear during flight		Wires to short	Cord catches on other wire harnesses, etc.		Once in awhile they slip out when I adjust my helmet.	Sweat works it out.		Not too bad	Fall out	I use the "shorts" which tend to pull out easily				
Q17 CEP durii	0	-	-	-	-	-	0	_	-	-	0	0	•	0
Q16 Wires pull on CEP when turning head	They slide out during any rapid head movements.	Too short	Sometimes. See #14			If cable catches on seat belts.	Sometimes wire gets in between my collar and neck. The wire sticks to my skin and pulls.	Not too bad	Too short			Sometimes get caught on shoulder straps and vest.	Doesn't happen very often. The wires sometimes work themselves between the ALSE vest and the seatbelt/shoulder harness. When you turn your head, it pulls.	They catch on shoulder belts and survival vest behind me.
Q16 Wire when	-		-	-	0	_	-	_	-	-	0	-	-	-
Q15 Discomfort inserting CEP	The plastic core.		Pressing earplugs is sometimes painful	Too big		They poke the sides of my ears.			Too deep		Until I got used to the plugs, they scraped your ear when putting them in.	Have to push them in deep in ear so they don't come out when putting helmet on.		It's a little big for my ear canals.
Q15 Disc	it 1	0	ii. 1	-	0		0	0	-	0	-	-	0	-
Q14 Difficulty in fitting CEP	It goes - but intermittently it slides out and I have to continuously readjust the earplug throughout the		Difficult to fully put CEP in. Often the wires catch on NVG goggle cord/power supply cord.	Too big		The first set was too big.						Difficult to put helmet on without moving ear plugs.		
됨	1	0	•••	-	0	-	0	0	0	0	0	-	0	0
	1	2	m	4	ν.	9	7	∞	6	-	7	m	4	'n
Q1 Unit location	4.								ı	ń				

Q1 Unit location ID Nu	Num Num		Q14 Difficulty in fitting CEP	Q15 Discor	Q15 Discomfort inserting CEP	Q16 Wires when t	Q16 Wires pull on CEP when turning head	Q17 CEI duri	Q17 CEP move in/out of ear during flight
ઌ૽	9	0		0			The CEP pulls due to wiring laying about the pilots shoulders/neck and coming into contact with other hardware - i.e. wires seathelt	0	
	7	-	Explained in #12	—	Explained in #12	- I	Only sometimes. Out of 10 flights maybe three.	-	Same as #16.
	o o	-	The post is so large that slim/short foam tips cause discomfort resulting in use of the standard.	0			Minimal, due to extreme amount of plugs, wires, cables, vests and other misc. equipment jammed into a small cockpit.	0	
	6		To long and a little stiff feeling inside the ear.	0	1	- u	Gets caught in my vest behind the helmet.	0	
	01	0		o .	1	-	Only when it gets tangled with the communication plug-in. But if you plug into the aircraft last it doesn't cause a problem.	0	
	=	0		1 to	After putting the helmet on, the CEP tends 1 to slip and I have to readjust them.		They get caught in the hamess straps or between my neck and collar.	-	Only once in a while when the wires get caught
	21	0		0	1	1 A	At times, not always.	0	
	13	O		0	0	0		****	Short wire sometimes. Why-unknown. I think it catches on the helmet or shoulder harness or something
	14	0		0		c		•	Silling to seeing
	15	0		0) 			> <	
	16	-	They seen to be slightly too long, pressure from the ear cup causes slight discomfort to the outer ear.	0		C	Occasionally, not a big deal.	• •	
9.	-	0		c	-	_			
	7	0		0	0	, .		o c	
	e	0		0	-	≶ ŏ	With goggles and mic cord, the earplug cords get pulled.	· —	Only sometimes.

Q17 CEP move in/out of ear during flight	If adjusting helmet, tend to fall out.			Only if it gets snagged.					Only during transition wear		When the wire is caught on something while turning your head, an earplug can be pulled out of the ear. That's a real pain too	From time to time - not always	A few times during flight my CEP has fallen out of my ear.		
Q17 CEF	-	0	0		0	0	0	0	_	0	1 eat		-	0	0
Q16 Wires pull on CEP when turning head	Wires get hung up on numerous things (shoulder harness, NVG cable, mic boom, etc)		Once in a white when CEP/NVG power supply/ODA cables get twisted together.		Wires get caught on flight vest,		They catch on stuff.			The wire gets caught on my vest or seatbelt and pulls a little, but it has not been a real problem	Solution is to bundle the wire between the NVG weight pack and helmet Velcro, but it is still a pain. The wires get caught on the scatbelt guide and they can be pressed between your back and the seat	Drag across back of neck (especially when sweaty), sometimes catch on NVG cables or on flight suit collar.	Wires get caught on survival vest.	Ear cushions press against head, can feel pulling of wires when turning head.	
omfort inserting CEP	Occasionally the solid plastic portion will 1 scrape ear canal or be inserted too far.	0	I	1	If pushed in, the inner portion can be felt 1 against inside of ear.	Tip would cause discomfort after 3-4 hours.0	They are uncomfortable	-	I found the standard plugs to be too large 1	The discomfort is only present when the earplug is not properly in the helmet earcup		Initial issue had standard size. Changed to 1 slim.	-	The sharp edges on the exterior piece. 1	
Q15 Disc	1	0	0	0	_	-	_	0	1	-	0	-	0	-	0
Q14 Difficulty in fitting CEP	0	0	0	0	0	0	0	0	. 0	1 The earplugs were too long and they were touching my eardrum and causing pain	0	0	0	0	0
Ξ	_						01	-							
!	4	S	9	7	∞	6	-	1	7	ю	4	ς.	9	7	∞
Q1 Unit location	6.						7.								

Q1 Unit location	2 B 2		Q14 Difficulty in fitting CEP	Q15 Discomfort inserting CEP	Q16 Wires pull on CEP	Q17 CEP	Q17 CEP move in/out of ear
					witch turning fread	anrın	auring tilght
7.	6	-	Sometimes the foams don't fit right.	1 When the foams don't fit	Unless I drape the wires over the rubber cover where the CEP plugs into the helmet to get them out of the way.	0	
	10	0		0	1 When turning right	-	Left slip out in right head movement.
	=	0		0	1 Hang up on nape strap and collar.		When wires pull.
	12	0		0	 Wires get caught on collar and nape strap. 	_	Only when wires are caught.
	13	0		0	1	-	A few times but only when they are very dirty.
	14	0		1 The plug does not form shape as readily as the yellow foam earplugs. Hard to insert.	0		If not properly inserted it tends to come loose
	15	-	Sliding the helmet over the plugs.	, 0	0	0	
	16	0		0	1 Wires catch on goggles sometimes.	0	
	11	0		0	1		
•	2		Did not fit, fall out.	-	1	,	
	19	-	Foam does not expand fast enough and cord pulls earplug out.	Little plastic tubes can scrape inner ear.	The wires pull on my earplugs when I turn my head	0	
	20	0		1 Occasionally the plastic insert extends beyond the foam and pokes me in the ear.	 Only when I have them stuck on something behind me. 	0	
	21	0		0	 Sometimes the wire catches and tugs on the earplugs. 	0	
,	22	_	Hurt the ears with the probe going down the canal.	0	0		Because they hurt, I would leave them loose.
·	23	0		0	 Every once in a while if wires are twisted. 	0	
xi	-		Originally I was given a small and sometimes have a hard time with goggles	0		0	<i>i</i> .
			aligning.				

				I					
Q1 Unit location	Q1 ID Num		iculty in fitting CEP	Q15 Disco	omfort inserting CEP	Q16 Wires when	Q16 Wires pull on CEP when turning head	Q17 CEP durin	Q17 CEP move in/out of ear during flight
ο.	7	0		0	-	ļ. —	Every time I turn to the left, my right earplug gets pulled on.	_	Right ear plug does not fit properly, not known if it is my ear or the fram also
	m	-	Started off with standard length which caused discomfort in my ear canal because of length. Switched to short which eliminated the problem.	0	-	•	They hang up on shoulder harness and upturned flight suit collar.	-	When the wires hang or pull.
	4	0		0	-			-	You must ensure a very good fit prior to flight to ensure they stay in.
	so v	0 •		۰,	0			0	
	0								
	∞	0		-	Just a slight discomfort	•	They catch on the nape of my neck, especially when sweating.	0	•
	6	0		0	-		They get caught on the flight suit collar, safety harness, ICS cord, NVG retention strap.	0	
	10	-	The foam plugs are too mushy and start to expand very quickly. The housing hurts when it is pressed by earcups.	0	-			-	Seldom
	=	0		_	Discomfort after 2 hours. 0			_	Sometimes
	12	0			Initially there was discomfort after flying 1 for 1 hour or more.		Excess wire catches on clothing and other wires.	0	
	13	-	Very narrow ear canals - must trim the slim ones even slimmer - plus the foam spins off tot easily.		Inner tube too rigid - scrapes inner ear	•	They catch on everything	0	
	14	0		0	0			0	
	15	0			1			0	

	Q17 CEP move in/out of ear during flight		Due to my ears. As in #14				#14				Sometimes on long flights	The center core sometimes prohibits the sponge insert to compress small enough for proper fit.				
	Q17 CEP move in during flight		Due				See #14				Som	The proh com				
	00 ಕ	k o	1		0	0	6, či	0	C .	O L T			0	C		0
	Q16 Wires pull on CEP when turning head	Usually occurs after 2 hours of flight. Wires hang up on my neck and when I turned my head - it pulls the plus out				Sometimes when not installed properly.	Only if wire comes loose of Velcro, usually occurs on NVG flights with other wires Velcro to helmet.		The wires catch on seat belts and other items. In the South with the humidity the wires stick to your neck and pull out when you turn your head.	Occasionally when wearing other cords around the neck (NVG cord, flashlight)			Turning my head hard to my left pull on the left side plug wire.	1	The Velcro comes loose with NVG battery pack installed	
I	Q16 Wire	-	0		0	-	-	_	-	-	0	0		0	-	0
	Q15 Discomfort inserting CEP		Same as #14				Scraping of canal		After prolonged wear the center tube irritates the ear canal.				They are too big.		The edges on the end are sharp	May be too large.
l	Q15 Disc	0	-		0	0	-	0	-	0	0	0		0	-	-
	Q14 Difficulty in fitting CEP		Constantly jabbed ear when inserting them because my ear canals are irregularly shaped				Finding the right size plug and keeping it in the ear canal.									May need slim plugs
		0	-	•	0	0	-	0	0	•	0	0	0	0	0	_
	Q1 ID Num	16	17	•	_	7	ю	4	'n	9	7	∞	6	01	11	12
	Q1 Unit location	∞ .		9.												

Q1 Unit location	Q1 Num	Q1 Q1 Q14 Unit location ID Difficulty in fitting CEP Num	Q15 Discomfort inserting CEP	Q16 Wires pull on CEP when turning head	Q17 CEP move in/out of ear during flight
6.	13	0	0	1	1 When it gets caught on flight vest and there is head
	14	0	0	I Wires tangle in/on other wires and	1 0
	16	1 Difficult to keep them in while putting helmet on.	1 With standard size	ataonnents.	1 After 30 minutes -1 hour when flying in hot and humid environments (86+ degrees. Sweating caused the CEP to slip out during flight.
10.	-	0	0	Sometimes I think it is when the wires are more toward the cheek than the chin.	0
Overall Total N = 152	N = 152	Yes = 35 N = 117 NR = 0	Yes = 50 N = 100 NR = 2	Yes = 114 N = 38 NR = 0	Yes = 70 N = 81 NR = 1

21 Juit location	S C Z	Q1 Q18 ID SHORT Num wire	LONG	Q19 Night flight	Q20 Connector	Q21 Connector location	Q22 Clean or	bū	Q24 Wax	
			QIII.	properties	merterence	convenient	change tips	process b	dn-plinq	
•	_	Just right	Just right	0	0	-	20 hours	Wash in flight suit	c	
	7	Just right	Just right	0	1 Sometimes it will interfere with NVG power cord		25-30 hours	Wash them with my flight suit	0	
	ю	Just right	Just right	0	 Power cord to NVG battery pack 	-	Insufficient #s to know	N/A	0	
		Just right	Too long	0	0		Haven't yet		C	
		Just right	Too long	0	0	 I don't know of another place. 	. 50	rubbed between hands with soap.	· -	
	9			0	1 Sometimes. See #16	1	Cleaned about 25 hours	wash in hands with soap	0	
	7	Too short	Too long	1 Same as above	0	-	5 hours	Wash in flight suit	_	
	∞	Just right	Just right	0	 Earcups when putting helmet on 		Haven't	Haven't	. 0	
	6	Just right	Just right	0	1 Sometimes. See #16	-	When they get dirty	Put them in my flight suit pocket during laundering.	0	
	01			 Wire gets hung up and hard to find and secure. 	1 See above	-	N/A, only lasted three flights	N/A	0	
	=		Too long	0	-	1	Once every three months	Washed with uniforms	0	
	12	Just right	Just right	0	0			Washed in flight suit pocket	0	
	13	Just right	Just right	1 Sometimes the CEP wire gets caught on all of the other wires hooked to the back of the helmet	1 See above	-	Whenever they appear dirty	Left them in my flight suit pocket and washed it	-	
		Just right	Just right	0	1 Sometimes on your clothes	1	10 hours	In the pocket of ABDUs in washing machine		
	15	Just right	Just right	0	1 As described in #16	1	Bi-weekly	In flight suit in washing machine	0	

ector locatic	Q21 ctor Connector location ence convenient	Q20 Q21 Connector Connector locatio interference convenient	Connector interference	Night flight Connector problems interference	LONG Night flight Connector wire problems interference	T LONG Night flight Connector wire problems interference
		0	Sometimes when 0 turning head one of the CEPs would pull - wire adjustment fixed problem	1 Sometimes when 0 turning head one of the CEPs would pull - wire adjustment fixed problem	1 Sometimes when 0 turning head one of the CEPs would pull - wire adjustment fixed problem	Just right 1 Sometimes when 0 turning head one of the CEPs would pull - wire adjustment fixed problem
In earcup, or volume cont helmet	Imet wire, seat back 0 In earcup, or separate volume controls on helmet		Helmet wire, seat back 0	0 1 Helmet wire, seat back 0	Helmet wire, seat back 0	Too short 0 1 Helmet wire, seat back 0
	.	0	0	0 0	0 0	Just right 0 0
	G strap catches it 1 lpulls CEP from ear	1 NVG strap catches it and pulls CEP from ear	Same as above. 1 NVG strap catches it 1 See Q #15-17 and pulls CEP from ear	1 Same as above. 1 See Q #15-17	-	1 Same as above. 1 See Q #15-17
	'Gs 1	1 NVGs 1	NVG neck cord. 1 NVGs 1 See #16	1 NVG neck cord. 1 See #16	-	1 NVG neck cord. 1 See #16
	1	0 1		0	0	Too long 0
	-	0 1	0 1			
Move on the	Move on the side	0 Move on the	0	0 0	0	0 0
		0	Getting tangled 0 1 with the NVG battery pack.	 Getting tangled with the NVG battery pack. 	1 Getting tangled with the NVG battery pack.	Too short 1 Getting tangled with the NVG battery pack.
	1	0 1	0 1			Just right
	atches on intercom 1 e and seat belt.	 It catches on intercom wire and seat belt. 		0	0	Too long 0 1
	1	-	Velcro rubs on 1 1 neck. Get rid of Velcro.	-	Just right 1 Velcro rubs on 1 1 neck. Get rid of Velcro.	-
	;#16 1	1 See #16 1	See #16 1 See #16 1	1 See #16 1	1	Too long 1 See #16 1
	tches on survival 1 t and pulls out of s	1 Catches on survival 1 vest and pulls out of ears		0		0
	cept as above 1	0 Except as above 1		1 As stated in #16 0		1 As stated in #16 0

Q1 Unit location	Q1 ID Num	Q1 Q18 ID SHORT Num wire	LONG	Q19 Night flight problems	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Cleaning process	Q24 Wax build-up
2.	∞	Too short	Too short	0	0	-	After each flight	Wash in flight suit	
	6	Just right	Just right	0	. 0	-	10-20	Soapy water	0
	10	Just right	Too long	1 See #16	 Wires catch on nape strap buckle 	e nd	60-70 hours	Was told not to clean - get new ones	
	=	Just right	Just right	0	1 See #16		Do not have any to replace. Need more foam inserts	Warm water	-
	12	Just right	Just right	0	1 ICS cable has at times pulled from my ear canal	-	30	Just changed them out	o 11
	13	Too short	Too long	0	 Long wire gets caught on vest 	1	20	Wash in flight suit pocket	0
	4	Just right	Too long	0	 Vest - pinches between vest and neck 		Not cleaned yet	Still work. Don't break up a good thing	ak 0
	15	Just right	Too long	0	0 Very infrequently	-	30 hours	Hand wash in soap and water	0
	16	Too short	Too short	0	 NVG flight on battery pack wires 	1	10	Washed in flight suit	0
	11	Just right	Just right	1 Speaker cutting in and out	1 Shirt/goggle		10-15	Wash with flight suit or exchanged	
	8	Just right	Too short	O Wires would be attached to bottom of helmet up to the point at the bottom of the ear covers (cups)	1 Anything behind neck	-	Not many	Got new ones or washed with uniform	
				0	0	0 It should be inside, under CEP, to minimize. Wires are always in the way	Once a week 26. e	soap and water	0

Q1 Unit location	Q1 ID Num	Q1 Q18 ID SHORT Num wire	LONG	Q19 Night flight problems	Q20 Con inter	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Q Cleaning V process b	Q24 Wax build-up
.5	20	Just right	Just right	1 Can sometimes get caught on things in the aircraft or tangled in other helmet mounted equipment	mes get 1 ings ft or ther nted	Can sometimes get caught on other equipment but has little effect on job performance to the negative		130 hours	Didn't	o .
÷.	-	Too short	Just right	1 Gets tangled with NVG cord	1 with		-	25-30	Soap and water	0
	7	Too short	Just right	1 Stem broke- earplug stuck in	Hii	50% vest	-	Every time wash fligtsuit	Leave in flight suit pocket and clean in washer	0
	က	Too short	Just right	0	0		1	20-30	Leave them in left shoulder pocket during washing	0
	4	Too short	Too short	1 See #16	_	See 16,19		Every two weeks or as needed	Wash them	0
	so.	Too short	Too long	0	-	Wire length too short or long and limited space in a/c	0 L or R side of helmet	50	Hot water	-
	9	Just right	Just right	1 See question 16	n 16 0		,	Monthly	Put in pocket when washing flight suit	0
	r	Just Right	Just right	Installing the CEP in the back of the helmet at night occasionally proves difficult	ie CEP 0 of the ight y cult		1	occasionally	Placed in pocket of flight suit and laundered.	-
	co .	Just right	Just right	1 With the application of ODAs and NVGs that is too many items attached to our helmet	o f NVGs nany ied to	See 19	o	Never did	Didn't	0
	6	Just Right	Just Right	0	0			100	Wash/laundered	1
	0 =	Too long	Too long	0 0	00			unknown 150	Wash with flight suit Replaced	0 0
									•	

Q1	5	Q18				Q21	022	Q23	024	
Unit location	Num	ID SHOKI Num wire	wire	Night flight problems	Connector interference	Connector location convenient	Clean or change tips	Cleaning process	Wax build-up	
က်	2	Tree simple	Inst dight	F						
	71	जिल्ला महिता	Just right	1 100 many wires	-		9	Washed in flight suit pocket		
	13	Too short	Just right	0	0	1	15	Washing machine - in pocket of clothes	ii 1	
	14	Too short	Too short	0	0		150	Replaced	0	
	15	Too long	Too long	0	1 ICS cord and vest	1		Stopped using	· –	
	16			0	0	0	Did not wear long enough	·	0	
4	17.	Just right	Just right	0	1	-) .		0	
:		Too short		0	1 Vest or goggle mount			Wash		
	7	Too short	Too short	0	1 Collar		Every month or so.	Washed them in my flight suit.	0	
	e	Too short	Just right	0	1 Only to the extent of inconvenience.	O The side, if not, just make it easier to plug in with gloved hand.	I month	Left in flight suit while laundering	nile 0	
	4	Too short	Too short	1 Same as day	-	0	Each time	Water	0	
	v	Just right	Just right	1 You have to make sure you have all your ALSE gear on before you put on your CEP.	1 Too many wires in the cockpit, i.e. NVG commo	_	5 hours	Put in flight suit then washed it.	-	
	9	I don't know.	I don't know. I don't know.	0	1 Seatbelt	0	30-40 hours	In my hand with soap.	o d	
	۲ .	Too short	Just right	0		0 It's hard to get plugged in. I don't think moving it would help.	Haven't cleaned		• .	
	∞			0	1 Not too bad	_			C	
	6	Too short	Too short	1 Fall out	1 NVG neck piece	0 Bigger and easier connection	5 hours	wash	_	

or Init location	Q1 C1 Num	Q18 SHORT wire	LONG	Q19 Night flight problems	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Cleaning process	Q24 Wax build-up
•	-	Too short	Too short	0	Wire tends to lodge under shoulder restraint and pull loose.		N/A	NA	0
	7			0	. 0		40	Soap and water.	0
	3	Just right	Just right	0	0	-	Clean weekly	By hand with soap and water.	
	4	Too short	Just right	0	0		About 10	Left them in flight suit pocket and washed flight suit.	ı,
	ۍ	Just right	Just right	0	1 See #16	-	Have not cleaned them yet.	,	0
	9	Too short	Too short	I Going thru the process of plugging in the CEP to the helmet	1 See #16	0 On the back with finger guides to the CEP hole, thus requiring you not to look at where the plug in is.	9. 39	Warm soapy water then rinsed them in hand under sink.	•
	7	Just right		Sometimes it tangles around the aircraft battery.	0	_	50 hours	Water	0
	∞	Just right	Just right	0	0	-	I'll never tell.	In flight suit and normal wash cycle.	0
	6	Just right		0	1 Refer to #16.	0 Hard to put in with helmet on	Haven't yet.	N/A	0
	10	Too short	Just right	0	0		Didn't change them yet.	Washed in machine in pocket of flight suit.	0 1
	=	Didn't know they had different wire lengths.	Didn't know Didn't know they had they had different wire different wire lengths.		0	_	So far - never,	N/A	0
	12	Just right	Too long	0	0	1	Clean them every 4 flights (10 hours).	Soap and water	0
	13	Too short	Just right	0	0	0 On the side	Haven't had them long enough		

Q1 Unit location	Q1 Num	Q1 Q18 ID SHORT Num wire	LONG	Q19 Night flight problems	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Cleaning V process b	Q24 Wax build-up
5.	14	Just right	Just right		0	1	Have not cleaned		0
	15	Too short	Just right	0	1 Catches on shoulder	1	yet Not done yet.	Not done yet.	0
¥	91	Just right	Just right	0	0	-			0
ó		Too short	Just right	Initially hard to get used to because I never wore earplugs prior to the CEP modification.	0	0 Once the ECU comes on Monthly line, what are we going to do?	on Monthly	Washed them IAW briefing instructions (flight suit pocket).	0
	7	Just right	Just right	0	0	0	Never	I don't, they're great.	0
	3	Just right	Just right	0	0	-	Haven't yet.	Haven't yet.	-
	4	Too short	Just right	o	0	-	10-20	In ABDU flight suit pocket in washing machine.	0
	2	Just right	Just right	0	0	0	N/A	Wash and drver.	c
	9	Too short	Just right	0	1 See #16	1	30	Wash with flight suit.	0
	,			0	0	-	10 hours	Water	0
	x 0 (loo long	Too long	0	1 Tends to get caught	0			0
	0	Just right	Too long	0	 Long wire would catch on flight vest. 	1	Washed with flight suit.	Regular washing.	0
7	٥.	Too short	Too long		1 Catches on vest.	0 The side.	Don't wear it.	N/A	0
:	-			0	 Especially when wearing NVGs 	1	haven't	replaced them	0
	7	Just right	Just right	0	0		100	Soan and water	c
	e	Too long		0	0		50	Tried to wipe them off with a damp cloth	

Q1 Unit location	Q1 ID Num	Q18 SHORT wire	LONG	Q19 Night flight problems	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Q Cleaning V process b	Q24 Wax build-up
7.	4			1 There are already too many wires coming off your head, There is the oversized ICS cord, 550 cord for NVG, A/C power for NVGs, ODA cord, and the CEP cord. I'd hate to think what flying in an NBC environment would be.	1 Sec#16	Perhaps two short wires 10 located on the helmet nearest the ears. The best solution is no external contraption.	10	Soapy water and rub between fingers	•
	5 0	Too short	Too short	 From time to time catches on NVG power supply cable system. 	1 As explained				0
	9	Just right	too long	0		-	100	Washed with flight	-
	7	Just right	Too long	0	1 Seatbelt	-	When dirty	Placed in flight suit pocket and laundered	
	∞	Just right	Just right	0	0	1	75	I don't	0
	6	Just right	Too long	0	I Occasionally	-	Periodically	Wash	-
	01	Just right	Too long	0	0		No replacements		0
	=======================================	Just right	Too long	0	0	-		Replaced	-
	21	Just right	Too long	0	1 See #17	1	Never - too hard to replace	Soapy water	-
	13	Just right	Too long	0	0	1	09	Never cleaned, just replaced	0
	4	Just right	Too long	0	1 We wear ANVIS power cords and flotation, it tends to snag.	-	10	Replaced	0
	15	Just right	Just right	0		t owd	Kept breaking, didn't get a chance to clean them.	Didn't	0
	16	Just right	Just right	0	0	-	100	Replaced	_

Q1 Unit location	Q1 Q18 ID SHO Num wire	Q18 SHORT wire	LONG	Q19 Night flight problems	Q20 Con inter	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Cleaning process	Q24 Wax build-up	
7.											_
	17			0	0		0	٧c	Water	-	
	18		Too long	1			0 Inside	. 01	File 13	> c	
	61	Just right	Too long	0	-					> -	
	20	Just right	Just right	0	0		,	10-100 depending	When washing flight	. 0	
	21	Just right	Just right	0	-	Sometimes		on color 75	suit Replaced	-	
	. 22	Just right	Too long	1 Same as above	ve 1	They get hung on seatbelts behind my head.	0 Try doing it at night while on a real world mission with a 15 minute launch time.	25 I nute	Soap and water	0	
	23	Just right	Just right	0	0		1	15	With flight suit in pocket.	-	
∞	-	Just right	Too long	0	0		•••	50 hours (1 month)	Washed in flight suit		
	7	Just right	Just right	0	1	We have other wires strapped to our helmet, it tangles up.	1	Once a week	pocket with roam In my flight suits in the wash and air dry.	the 1	
	æ	Just right	Too long	 Sometimes pulled by NVG power cord and ODA cable. 	oulled 1 wer AA	See #16 and #19	0 Inside helmet to eliminate exposed wires	50 ires	Washed in flight suit pocket	0	
	4	Too short	Too short	1 CEP wire entangles in ICS wire, ODA, NVG power supply. I'm a flying octopus.	ntangles 1, ODA,	Sometimes catches and restricts head movement.	_	20 hours	Soap and water		
	'n	Just right	Just right	0	0		-	Have not changed them	Have not cleaned them	o wa	
	9			-	-		0	Never	d/n/a		
	7		Too long	0 I did not try it.	it. 1					0	
	∞	Too short	Too short		-	In the OH-58D we have several other cords to contend with.	-	100	In my flight suit in the laundry		

ĮŅ.	19	Q18		Q19	Q20	Q21	022	023	024
Unit location	ID Num	ID SHORT Num wire	LONG	t flight lems	Connector interference	Connector location convenient	Clean or change tips	ning cess	Wax build-up
%	6	Just right	Just right	0	1 See #16		45	Replace the extremely	y 1
	10	Just right	Just right	0	. 0	1	S	Washed inside flight suit nocket	0
	=	Just right	Just right	0	0	-	100	Swapped out	0
	12	Too long	Too long	1 See #16	1 Catches on NVG/ODA cord and ICS cord	-	10	Laundered in flight	0
	13	Too short	Too short	0		 Individual wire and connector for each ear. 	1 week needed replacement	Soap and water	-
	14	Too short	Too short	0	0	1	25	Threw them away	0
	15	Too short	Just right		1 The OH-58D has three other wires attached to the head/helmet and ANVIS	_	I didn't		0
	16	Just right	Just right	1 Plug pulls out. See #16.	1 Occasionally it will hang up on other helmet parts	_	100 hours	I didn't. I replaced them.	0
o	17	Just right		0	0	0	10 hours	Washed in flight suit	0
;	-	Just right	Just right	0	0	1	25 hours	Wash in pocket of flight suit	0
	7	Just right	Just right	0	1 NVG neck cord/chin strap	-	50 hours, need more tips	Leave in pocket of flight suit during wash	0
	က			1 See #16	0		60 or 80 hours (clean at 20-40)	Soap and water	
	4	Just right	Too long	0	1 Long wire on vest sometimes.	1	Every 2-3 flights	Wash in arm pocket of flight suit.	ıf 1
	'n	Just right	Too long	1 Extra wires are getting caught on items in aircraft.	1 They catch on seatbelts, ICS cords and stick to you.	1	20	Wash with flight suit	0
	9	Just right	Just right	1 See #16	0	1	20	Wash in flight suit	0
	7	Too short	Too short	0	0	1	100 hours	Flight suit pocket	-

Q1 Unit location		Q1 Q18 ID SHORT Num wire	LONG	Q19 Night flight problems	Q20 Q21 Connector Con interference conv	nector location venient	Q22 Clean or change tips	Q23 Cleaning process	Q24 Wax build-up	
9.	∞	Just right		0	0		10	Inside flight suit	0	
	6	Too short	Just right	0	0			Clean them?	• •	
	10	Too short	Just right	0	0 1		10	Washed in flight suit pocket		
	Ξ	Just right	Just right	1 See #16	0	0 It would be better if all connectors were in one plug	I haven't	See above	0	
	12	Just right	Just right	0	0		Haven't vet	Haven't vet	c	
	13	Too short	Just right	0	1 Flight vest 1		•			
	14	Just right	Too long	0	0		Clean once a week	Wash with flight suit		
	15			0	1 Other attachment - NVG 0 cord	Somewhere more convenient.	Every flight	Washed in flight suit		
	91	Too short	Just right	1 Too many cords and wires to hook up and keep from getting tangled I.e. CEP, NVG battery pack, NVG lanyard, extension cable for battery pack, ICS cord, ODA cord!	•			Flight suit pocket in wash	0	
10.	-1	Just right	Just right	0			100, I'm lazy.	Flight suit pocket in washer	0	
Overall Total N = 152	N= 152		Short-Just right 134 Long-Just right = 132	Yes = 40 N = 109 NR = 3	Yes = 78 Ye N = 72 I	Yes = 118 N = 28 NR = 6		·	Yes = N = 1	75 11 4

rall fit fort	1 1 4 4	t 2	4 4 7	0 4 4 <i>4</i>	r ω 4	
Q29 Rate overall fit and comfort	·					
Q28 Onset of CEP discomfort	2 hours 2-3 hours 4+ hours	2 1/2 hours 2 hours 2 hours	1/2 hour 2 hours	2 hours 4 hours	1/2 hour 3 hours	3 hours
Q27 CEP hot spots	1 When CEP comes in contact 0 0 0		1 Ears hurt 0 0 0 I hour	•	0 1 In ear canal	
Q26 External ear discomfort	0	1 Only if wire runs across ear and earcup - easy to fix. 0 0	 1 See #15 0 0 0 1 Sometimes the wire coming out 	from under the earcup causes pain behind my ear. 0 0 0	It just seems the black portion's inner cylinder (not the part that the foam covers) irritates the outer portion of my ear canals	0
Rate] discomfort	1 1 If inserted too far	1 2 2 1 Itching	1 2 If they start to		2 1 Both itching and	pain 2
Q25 Canal discomfort	- 1 0 0 1	(-	0	0 -		0 -
Q1 ID Num	- 2 6 4 5	0 0 0 0	2 1 2 1 2	14 15 16 17	8 6	20
!1 /nit location						

Q1 Unit location	N ID &	Q25 Canal discomfort	Rate discomfort	Q26 External ear discomfort	Q27 CEP hot spots	Q28 Onset of CEP discomfort	Q29 Rate overall fit and comfort
-i -	23	0		0	0		4
7.	-	c				;	
	. ~				-	4 hours	4
	ı m	·	1 Itching	0		1 hour	7
	4	0)	0	· 0		,
	S	-	 On long flights mildly uncomfortable. 	0	0	2 hours	- 4
	9	1		0	0	2 1/2-3 hours	4
	7	0		0	0		4
	∞	-	9	0	0	1 1/2 hours	2
	6	0		0	0		4
	10	0		1 Barrel of external earplug pressed against outside ear due to pressure from earcup	1 See #26	2.5 hours	· m
	Ξ	0		0	0		7
	12	0		0	0		4
	13	-		0	0	1/2 hour	7
·	14	0		1 Cord - at times pinches between earcup if not positioned correctly	0 After 2.5 hours	4	
	15		1 Sometimes on long flights	0	0 2 hours	4	••••
	16	0		0	0		4
	17	0		0	0	3.5 hours	4
	<u>~</u>			0	0	i hour	4
	19	_	2	1 Too big	0	Less than .5 hour	2

Q1 Unit location	QI Num	Q25 Canal discomfort	Rate discomfort	Q26 External ear discomfort	Q27 CEP hot spots	Q28 Onset of CEP discomfort	Q29 Rate overall fit and comfort
4.							
	S	-	2	0	0		9
	9		2	0 Just canals.	0	1/2-1 hour	
	7	0		0	0		n 4
	∞		1	1 After 2-3 hours	0	3 hours	· v
	6	,	1	0	0	3 hours	s ve
5.							Þ
	-	proof	1	. 0	0	1 hour	4
	7		1	0	0		+ v
	33	-	2 Itching	0	0	1 bour	, c
	4		2	0	0		י ע
	5	-	2	0		1 hour	.
	9	0		. 0		mon y	~ .
	7	-	2	· 1 See #12.	0	1/2 hour	n u
	∞	0		0	. 0	1/7 IION	n •
	6	-	1 Pain	0	. 0	1/2 hour	4 •
	10	0		0	0	1001 7/7	† =
	11	0		0	0		+ 4
	12	0		0	0		o 4
	13	0		0 In a way the hard part inside the foam - if not rolled slowly the	0		> 4
				plastic may scratch on inserting the earplug into the ear.			
	14	0		0	0		v
	15	0		0	0		, v
	16			1 See #14	0	1/2 hour) er

Q1 Unit location	Q D Num	Q25 Canal discomfort	Rate disco	mfort	Q26 Exter	Q26 External ear discomfort (Q27 CEP	hot spots	Q28 Onset of CEP discomfort	Q29 Rate overall fit and comfort
	~	1	2	Initially moderately uncomfortable	0)	0		1/2 hour	4
	7	0			0	•	0			
	ю	-	_		0)	0			4
	4	0			0	9	0			. 4
	8	0			0)	0			· v 9
	9	_			0	1	_		1/2 hour	4
	7	0			0	3	0			
	∞	0			1 If	If wire lays on top of outer ear it tends to cause a hot spot.	-	See previous.	1 hour	4
	6	-	7	After 3-4 hours.	0	9	0		3 hours	4
	10		ю		1 E	The wires are pressed into my ear I from the earcup.	••••	Where the earcups push it into my ear.	1/2 hour	
7.						•				
	-	-	7		0		-	On my ear against the cushions	1/2 hour	4
	7	-	-		0)	0		1/2 hour then subsides	4
	က	1	_		0		0			4
	4	-	7	The part that protruded from my ear is in contact w/ earmuff and after an hour of flying it becomes painful enough to take the CEPs out.	∞ 	See #25 0	0		I hour	vs
	8	-	7		0	0	0		1/2 hour	7
	9	1	-		0	9	0		1/2 hour	7
	7	0			<u>щ</u>	Edges feel sharp 0	0			

Q1 Unit location	Num Num	Q25 Canal discomfort	Rate discomfort	·	Q26 External ear discomfort	Q27 CEP hot spots	Q28 Onset of CEP discomfort	Q29 Rate overall fit and comfort
7.	•	0			. 0	0		7
	6	••••	 Only when I get the wrong size. 	en I get g size.	0	0		. 4
	10	0			0	0		4
	=	0			1 Size of speaker	0	1 hour	
	12	0			0	0	1 hour	7
	13	0			0	0		7
	14	0		•	0	0		7
	15	0			0	0		
	16	0			0	0		4
	17	1	1 Itchy		0	0	1 hour	. •
	18	1	2			1	1 hour	4
	19	0			0	0		4
	70	1	1 Sometimes	es	0	1 Occasionally	3 hours	7
	21	0			1 Sometimes just a mild hot spot from the black plastic portion pressing against the outer ear	1 See #26	1.5 hours	4
	22	1	2		0	0	1/2 hour	4
	23	0			0	0		. 7
œ.	•	•						
	-	>			D D	0	1/2 hour	9
	7	0			0	0	3 hours	۰ و
	e	 4	2 Only with standard foam tip	h foam tip	0	0	1 hour	9
	4	-	2		0	0	1 hour	ĸ
	S		2		0	0	1/2 hour	m
	9	1	2		0	0	1/2 hour	_
	7	1	3			0	Less than 1/2	_

Q1 Unit location	Q1 ID Num	Q25 Canal discomfort	Rate discomfort	Q26 External ear discomfort	Q27 CEP hot spots	Q28 Onset of CEP discomfort	Q29 Rate overall fit and comfort
	~	-	-	Û	0	1/2 hour	7
	6	. =	. 2	0	0		- 4
	10	0		1 The housing sometimes is pressed against the ear by the helmet earcup.	0		9
	=		2	1 Soreness	l In ear canals	2 hours	4
	12	-	1	 Initial discomfort was gone after 20 0 hours. 	0 0	1 hour	9
	13	1	2	1 Where the wire presses on earlobe.	0 ::	2 hours	2
	14	0		0	0		7
	15	-	2	0	0	1/2 hour	3
	16	-	2 After long flights (2.5 hrs)	0	0	2 hours	9
	17		1 Itching	0	0	1/2 hour	4
9.	-	c		C	C		v
	7		-	0	. 0	1/2 hour	2
	33	-		0	0	1 hour	4
	4	0		1 The metal connector on the outside of car.	0		7
	ς.	-	2 After 3 hours	0	0	2 1/2-3 hours	
	9	1	1 Occasionally	0	0	1 1/2 hours	4
	7	0		0	1 Flight with NVGs	3 1/2 hours	9
	•	0		0	0		4
	6	0		0	0		9
	10	0		0	0		5
	=	0		0	0		9
	12	-	-	0	0	1 1/2 hours	7
	13	0		0	. 0		

Q1 Q25 Unit location ID Canal Num discomfort	QI ID Num	Q25 Canal discom		Rate discomfort	Q26 External ear discomfort	Q27 CEP hot spots	Q28 Onset of CEP discomfort	Q29 Rate overall fit and comfort
6	14 15 16	0 - 0		2 Itching	0 0 1 Hard plastic when trying to keep	0		4
10.		0	1		CEP in the ear. 1 Sometimes with the plastic part, however with the next generation there probably won't be a problem.			· • • • • • • • • • • • • • • • • • • •
Overall Total N = 152	N = 152	Yes = N = NR =	78 87	Mean = 1.6	Yes = 29 N = 123 NR = 0	Yes = 13 N = 138 NR = 1		Mean = 4.6 NR = 10

Q1 Unit location	Sum Num	Q30 Prob	Q30 Problem donning/doffing helmet w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem don/doff w/gloves		Q33 Discon discon	Q33 Discomfort if forget to disconnect CEP from helmet
1.		,		•				
	-	>		0	1 Next	Next to impossible	_	
	7	-		0		,	0	
	က	-	Care had to be taken when putting helmet on or it 0 pulled plug out	0	1 Canno foam s insert	Cannot compress foam sufficiently to insert	_	Caused plastic post to snap off
	4	0		0	0		_	Somewhat
	S	-		0	1 Muc	Much harder to feel the helmet adapter.	-	Plastic tips sometimes scrape.
	9	-	Extra care is required to not dislodge the CEP.	0	1 They	They are small	0	
	7	0			0		-	Due to the length of the cord, you rub them out of your ears.
	∞	-	Without spreading ear cups the CEPs normally hit the earcups. You must also take care not to pinch the wire while adjusting the helmet.	0	1 You	You can't do it.	0	
	6	-	Cannot put gloves on before donning helmet because I cannot put wire in helmet hole w/ gloves on.	0	1 Can'	Can't do it.		What does doffing mean?
	10	-						Plugs were pulled out of ear abruptly
	=	-	Takes more time	0	1 Hard	Hard to put in the car	0	
	12	-		0	0		0	
	13	-	Takes longer to get ready	0	0		0	
	14	0		0	0		0	
	15	-	You must be careful not to tug in the wires otherwise they pull the earplug out		0		0	
	91	-	Must take special care not to pull the wires out while doffing.	0	I Hard and s into	Hard to compress and seat the CEP into the ear	_	Yanks the ### out of your ear
	17	-	Remembering	0	0		0	
	18	,	The ear cups must be pulled over the black cylinders of as not to disturb them	0	0		0	

Q33 Discomfort if forget to disconnect CEP from helmet			The CEP would get yanked out of my ears.		Ripped them out of my ears.
9 D 9	0 0	s 00	86 88 58 1 1		- 0 0
Q32 Problem don/doff w/gloves		Hard to plug into helmet with gloves on Takes longer	While compressing the CEP to put into the ears, it is difficult trying to feel if you are twisting the earplug off. As far as connecting to the helmet, it is more difficult making the connection with the helmet.	Harder to plug in but not impossible. Cannot be done.	Locating where to plug the CEP into the helmet. I always insert w/o gloves on Sometimes hard to seat with connector with gloves.
Q32 Prob w/gl	00	1 0 1	-	0 = =	. 0
Q31 Significant problem completing mission W/extra step	0	0 0	0	0 0	0 0
Q30 Problem donning/doffing helmet w/CEP	You have to be more deliberate in donning the helmet	Care is taken not to pull earplugs outthumbs are inserted in ear cups to pull the earcups over the ears Must connect prior to putting on helmet	You just have to be more cautious about the wires and not pulling them out.	Careful placement of earcups around CEPs to prevent accidental dislodement.	Just need to pull earcups wider. Just hook-up/un-hook in sequence
	0 1	0 0	-	0 1 1	1 0 1
Q1 ID Num	20	22 23	_	2 ε 4	2 9 1
Q1 Unit location	∹		.		

	Q33 Discomfort if forget to disconnect CEP from helmet													Reliefi!	
	Q33 Disc disc			0	0	0	0	0 ,	0	0	0	0	0	0	0
	Q32 Problem don/doff w/gloves		It hurt like hell		Can't use gloves	Never done it	Cannot feel the HGU-56 connector to insert the CEPs	Getting proper fit sometimes takes 2-3 tries with gloves on. Gloves get CEP dirty quickly	No way can I place the CEP in the ear with glove on (same as regular earplugs). Plus connector into helmet is hard to find hole	Hard to plug into back of helmet with gloves on			I was only able to insert foam tips without my gloves	Can't feel	
	Q32 Prob w/gl		-	0	_		-	-	-		0	-	-	-	0
	Q31 Significant problem completing mission w/extra step		You've apparently never tried this yourself.					·					Only when facing time constraints	Wires in the way and distracting pain	
	Q31 Sign com		_	0	0	0	0	0	0	0	0	0	H 1	-	0
	Q30 Problem donning/doffing helmet w/CEP		More crap to plug in! We already have too much crap attached to our heads.	Have to pull the earcups further apart so that they don't pull CEPs out	Expand earcups further/ extra time to put on	Must pull earcups out to avoid CEP pulling out	It takes just a few more seconds to connect	Must spread helmet earcups apart further	Having to undo shin strap to allow total expansion of ear cups in order not to pull CEP	Must be careful not to pull them out when donning helmet	You must pull helmet wider apart to keep CEPs from getting worked out by ear cups		Only if CEP is caught on something and pulls out 1 of the ear canal	Very difficult process	Must be careful donning helmet otherwise CEP can be brushed out of the ear canal
į		·				_	~		-	-	-	0		-	-
	Q1 ID Num			6	01	=	12	13	41	15	16	11	<u>«</u>	19	70
	Q1 Unit location	2.													

	Q33 Discomfort if forget to disconnect CEP from helmet			Minor irritation as earplugs pull										pulled out of ear			
ı	Ö Ö Ö	l	•		0	_	•	0	0 _	0	•	• •		-	•	0	0
	Q32 Problem don/doff w/gloves				Negligible				It is impossible. I have to don/doff without gloves on				Must remove gloves to plug CEP in		Need the hand agility and sensitivity to feel where plugs need to go	Cannot compress foam to place in ear	•
I	Q32 Prob w/gl			0	-	0	0	0	-		0	0			-	-	
	Q31 Significant problem completing mission w/extra step		0	0	In combat situation when you need to be airborne in a hurry it could interfere	0	0	0	0	0	0	0	0	I If you touch earplugs at all it eventually falls out	0	0	. 0
	Q30 Problem donning/doffing helmet w/CEP			Must pull bottom of earcup out so as not to pull out CEP from ear	It takes longer to be ready for flight, also tends to get tangled with NVG retaining cord	0	1 It takes some time donning so the CEP is not pulled out		Slows down the process slightly	You now have to place your helmet on so it won't pull on the wires		The fall out easily when putting on the helmet		Have to stretch helmet out farther	Insert earplugs first, attach earplug to helmet, pull helmet on carefully, keep earcups pulled out as you don helmet		
	E							0			0	0	1 0	12	13	14 0	15
	Q1 Q1 Unit location ID	3.			m	4	ς,	9	7	∞	6	10	Ξ	 i	-		

Q1 Unit location	Q1 ID Num		Q30 Problem donning/doffing helmet w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem w/gloves	don/doff	Q33 Discomfort if forget to disconnect CEP from helmet	
સં	16	1 You heln	You must connect the CEP to the back of the helmet after donning it	0		I can't seat them with gloves. But I can't seat foam earplugs with gloves either	0	
_	17	1 Mu:	Must use side to side method	0	0)	0	
÷	-	I You and	You must pull earcups back to place over plugs and back, nape strap has trouble sliding out.	0	-	Think about it.	I It yanked on my ear.	
	7	1 Mus	Must slip one ear on at a time to avoid pulling CEP out.	0	-	Less feeling	0	
,	т	1 Incr	Increases time	1 It's just one more wire to put on, in addition to all the other equipment. It's not a habit yet.	-	It's easier to don with gloves off in order to plug in CEP to helmet.	0	
	4	1 Kno	Knocks plugs out	5000	0		0	
	v	I Pull	Pulling earcups wider to pull it over the CEP.	0 ,	-	The gloves create a different feel to the CEP. Plus the CEPs are small and hard to move around with gloves on.	0	
	9	1 You	You really have to watch out for those wires.	0 Unless its an immediate launch thing then I will just not use the earplugs.	-	I don't use the gloves because its impossible to find the plug for the CEP with them on.	1 The plastic digs the car canal.	
	7	1 I ha	I have to pull the helmet out from my ears as I put it on to keep from knocking out the earplugs.		0		 Hurts my ears. I only did it once though! 	uce
	∞	1 Tak	Takes more time.	0	-	Gloves on last	0	
	6	1 Mal	Makes them fall out	0	-	Connection is too small.	0	

Q33 Discomfort if forget to disconnect CEP from helmet		Pain when plugs are pulled from ears.							
	erity, 0 gloves.	, =	ves on, 0 ut the nector nto the telmet.	ove 0 inect k.	feel the 0 it to s when es.	•	to to	÷.	
Q32 Problem don/doff w/gloves	Lack of dexterity, feeling with gloves.		With the gloves on, it's hard to put the small tip/connector of the CEP into the plug on the helmet.	Have to remove gloves to connect CEP into jack.	You need to feel the device to fit it properly due to dexterity loss when wearing gloves.		Gloves on is difficult. It however is no problem to put gloves on after inserting CEPs into ears, and connecting to the back of the helmet.	Can't do it vet	
Q32 Problem w/gloves		-	-	-	-	C	· -		0
Q31 Significant problem completing mission wextra step	0 0	0	0	0	I If we are in a hurry Yes we hurry in aviation! Properly fitting the CEP is a hassle and induces more stress because it requires more time and patience when fitting.	0	0	0	0
Q30 Problem donning/doffing helmet w/CEP	Must be extremely careful in placing the earcups 0 over the ears since the plugs come out easily.	Helmet must go on before run-up so you can connect wires before gloves are donned.	You have to remember to connect the wires to the helmet after you put the helmet on.		This is the real problem with this product. You must plug in the CEP in your ears, then put on your helmet and lastly plug in your CEP to the helmet.		The sides of the helmet must be stretched outward just a little extra to ensure not to snag the CEP loose.	Have to put the wire in after donning the helmet.	You must grasp earcups and spread out to go over ears, to ensure you don't knock the earplugs out of your ear.
ш	1 1	-	_	-	-	0	-	1	0 1
Q1 Unit location ID Nu	5.	e.	4	v	vo	7	•	6	10

Q1 Unit location	Q1 ID Num	Q30 Problem donning/doffing helmet w/CEP	w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem w/gloves	don/doff	Q33 Discomfort if forget to disconnect CEP from helmet
5.	=	1 I put the helmet on early in the run-t	in the run-up procedure. 0	0	_	The ploves make it	c
		It takes a little more time.	•		•	hard to fit into my ears and connect to the helmet.	,
	12	1 Takes longer		0	-	Lose to much dexterity	0
	13	1 Pull the earcups out further to ensure they do not snare the wires.	they do	0	-	Same as yellow earplugs. Fingers are not as nimble with gloves.	
	14			0	0		0
	.12	I have to get careful not to pull them out when the earcups contact the wires.	out when	0	-	I cannot plug them into the helmet with gloves on.	0
	91	-		0	-	Can't be done with gloves.	
ં	-	1 A lot more time and more tenderness involved.	s involved.	0	0		1 The other pilots break the transducer wire on the right ear, next to the bottom or the transducer.
	7	1 It takes longer.		0	1	My hands are to clumsy with gloves.	0
	m	1 You have to be really careful when using NVGs or the mic cord. The CEP cords have to be on top of everything else.	ising NVGs to be on	0	-		0
	4	 More careful placing helmet ear cups over ears to prevent them falling out, plus additional step of plugging in connector. 	s over ears itional step	0	-	Can't get plug in heimet.	0
	S.	0		0	0		0
	9	0		0	-		0
	7	0		0	-		-
	∞	0		0	0		0

get to rom helmet		It is rough getting pulled out of my ears	The helmet pulled the plugs from the ear canal											
033 Discomfort if forget to disconnect CEP from helmet		It is rough ge my ears	The helmet p											
Q33 Disc disc	00	-	-	0	0	0	0	0	0	0	0	0	0	0
Q32 Problem don/doff w/gloves	Can't feel wires.			It is hard to locate the connector on the helmet to plug the earplugs into with gloves on	Putting any hearing protection w/gloves on is		I plug in the CEP into helmet prior to putting on my gloves.	CEP too small				Can't feel the wires.		I can't insert properly so I remove the gloves to insert the CEP.
Q32 Prob w/gl	0	0	0	-	-	0	-	-	0	0	0	-	0	-
Q31 Significant problem completing mission w/extra step	0 1 It is awkward.	0	0	0	0	0	0	0	0 1	0	. 0	0	0	0 P:
Q30 Problem donning/doffing helmet w/CEP	0 1 Have to pay close attention to the wires.	1 Just have to plug in CEPs	0	1 I hold the earcups away from my ears so they don't pull the earplugs out	 If one more thing to do before you fly. 	0	Must undo chin strap completely to don helmet.	1 Insert CEP, once helmet is on and aircraft is 100%, plug in CEP.	 I must carefully fit the ear portion of the helmet over the ear plugs. 	 Have to be careful going over ears. 	1 Must be careful not to pull out plugs	1 Put CBP in first and position wire not to get caught up on helmet.	 Put earplugs in first then wear helmet and 	1 At first the earcups had to be pulled outward significantly to keep the CEPs from being pulled out, but with experience its much easier.
Q1 ID Num	9 10	-	7	m	4	2	9	7	∞	6	10	=	12	13
Q1 Unit location	• •	:												

Q33 Discomfort if forget to disconnect CEP from helmet	It pull out of your ears and breaks the speaker stems.					Just hurt if it didn't break.	The earplug rip out of your ear.		Pulled on my ear canal.	
Q33 Disc disc		0 0 0		0	0 _			0	_	0
Q32 Problem don/doff w/gloves	The recessed jack is hard to find when gloved.		Cont necessaria	insert connector with gloves on. Cannot find the	Never have tried it. Always put them in without gloves on.	Too hard to do with gloves.	I usually put on my left glove then attach the wire and then put on my right glove.	I do it without gloves.		Difficult to locate plug and plug it in the back of the helmet.
Q32 Prob w/gl		0				-	-	-	0	
Q31 Significant problem completing mission w/extra step	0	0 00	0 0	.	0	When you are in a hurry it is hard to use them.	0	0	. 0	0
Q30 Problem donning/doffing helmet w/CEP	You must be careful to remove the plug prior to doffing the helmet. I put my gloves on after the helmet to allow for easy plugging in.	I have to spread the helmet apart so it won't catch on the ear plug and break off Slower	You have to hook up the wires - duh	I have to hold the earcups open more. Not a problem.	Need to spread the helmet/earcups more to slip over my ears w/o pulling out CEP.	Have to put them on out of the normal sequence for me. I have to wait to strap in. Refuel is where most problems occur. Getting out then in.	You have to connect the wire.			Requires earcups to be pulled apart more to prevent knocking plugs from ears.
		0 -		4 144		-	1	-	0	*****
Q1 ID Num	14	15 16 17	81 61	30	21	22	23	-	7	E.
Q1 Unit location	7.						c	ø.		

					I			
Q1 Unit location	Q1 Num		Q30 Problem donning/doffing helmet w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem w/gloves	gon/doff	Q33 Disco discor	Q33 Discomfort if forget to disconnect CEP from helmet
8.								
	4	0		0	-	Finger tip dexterity w/gloves does not allow for easy plug in of CEP.	_	Wires pulling earplug out.
	2	1 Y	You must pull the earcups out further.	0	0		0	
	9	-		0			_	
	7	1						
	∞	-	I must leave one glove off until my helmet and CEP is on,	0		See #31	0	
	6	1 C	Carefully spread the earcups and gently slide	0	_	Not enough feeling	0	
		Ö	over the CEPs.			to guide the helmet on without knocking the CEPs out of the ear.	,	
	10	1 S	Slower, more deliberate.	0	0		0	
	=	0		0	_	Never wear gloves	0	
	13	- -	Must use caution not to dislodge the CEP when donning the helmet	0	0	I do not attempt	0	
	13	0		0	-	Do it before you put your gloves on.	_	Ripped it out of my ear!
	14	0		 But could be in a combat environment. 	0		0	
	15	1 A	Additional steps to connect the CEP	0	1	I can do it but is more difficult.	0	
	91	— — % Q	Takes more time to don. Also you have to make sure that everything is positioned right so you don't hang up the cord and pull it out during	0	-	I can't. My gloves have to be off otherwise there is not enough sensitivity.	_	Mild pulling throughout ear canal.
	17	1	It is a pain to try to fit it up to the helmet.	I I'm in a time constraint and it always happens that I can't get it hooked up or it rips my ears off when I take it off.	-			Ripped my ears off !!!

Q33 Discomfort if forget to disconnect CEP from helmet				Yanks them out of ear.		Pulls CEP out of ears.								Yanks ears off.	Yanks ears off.	Wires are pulled loose from helmet connector
909	Ĩ	0	0	_	- x	-	0	0	0	0	0	0	_	_		
Q32 Problem don/doff w/gloves			I can't do it.		Your sense of feel is poor with gloves so its hard to feel the plug.	Hard to find insert point on helmet.	Unable when putting on helmet		Have to have gloves off.		I can't do it.	Can't do it.	Parts are too small and intricate.	Hard to insert with gloves on.	Loss of dexterity - can't do it.	Impossible
Q32 Prob w/gl	0	_	-	0	prod	_	-	_	-	0	-			-		-
Q31 Significant problem completing mission w/extra step	0	0	s. 0	0	0	0	0	0	0 Just aggravating		. 0 1	0	0	ս, Օ	0	0 nt 0
Q30 Problem donning/doffing helmet w/CEP		Added time chasing wires.	Requires adjustment to get over plugs and wires.		Takes a few seconds more to get the helmet on so you don't pull the earplugs out.	Have to remember to plug earplug into helmet.	Using earplug with helmet.		More things to hook up!	Plug in connector after donning helmet	It takes some practice to put the earplugs in and put the helmet on without pulling the earplugs	Takes a minute or so longer.	Much more time is required.	Earplugs in, cord over right shoulder, helmet on, plug in, climb in.	By virtue of more plugs and hardware.	Must be careful not to touch CEP. It will fall out 0 or become unseated.
	0	-	_	0	-	-	-	0		-	-	_	_	_	-	
Q1 ID Num		7	3	4	٧	9	7	∞	6	10	Ξ	12	13	14	15	16
Q1 Q1 Unit location ID	9.															

lmet		
Q33 Discomfort if forget to disconnect CEP from helmet		Yes = 36 No = 111 NR = 5
Q32 Problem don/doff w/gloves	1 Can't do it, but it's no problem.	Yes = 102 No = 48 NR = 2
Q31 Significant problem completing mission w/extra step	0 o	Yes 12 No = 139 NR = 1
Q30 Problem donning/doffing helmet w/CEP	1 I have to be a little more careful ensuring that the 0 earcups go over my ears so as not to pull out the CEPs.	Yes = 121 No = 31 NR = 0
	-	
Q1 Unit location ID Num	10.	Overall Total N=152

1	1																				•					
Q41 Rate weapons fire	٠	, ,	• •	4	4	7	ن	4	5		9	4	9	7	\$	9	4	9	9	7	7	\$	4		7	7
Q40 Rate monitoring A/C noises	3	, ,	9	3	5	4	9	4	٠		æ	4	3	4	8	3	4	9	9	3	-	7	4		2	4
Q39 Rate warning signals	7	7	9	9	9	7	9	7	7	s	7	\$	9	7	4	7	4	9	7	7	ю	7	4		7	5
Q38 Rate noise reduction	5	7	9	4	9	7	9	4	7	4	7	٧n	9	7	9	7	4	9	7	7	7	7	9		7	9
Q37 Rate overall speech clarity	7	7	9	9	7	7	7	7	7	S	7	7	9	7	7	7	9	7	7	7	7	7	9	•	7	7
936 Rate gender clarity (Male) (Female)	7	7	4	S	7	7	7	7	7	4	7	4	9	7	9	7	9	7	7	7	7	7	9		7	7
Q36 Rate ger (Male)	7	7	4	9	7	7	7	7	7	4	7	4	9	7	9	7	9	7	7	7	7	7	9		7	1
Q35 Rate ICS clarity	7	7	9	9	7	7	7	7	7	S	7	7	7	7	7	7	9	7	7	7	7	7	9	Í	7	7
Q34 Rate donning/doffing	4	9	3	3	3	4	ET.	_	4	3	3	3	2	4	3	4	4	ю	4		Э	4				4
. [-	7	3	4	2	9	7	oo	6	01	11	12	13	14	15	16	11	22	19	8	21	77	23	,		7
Q1 Q1 Unit location ID	1.										-													2.		

Q1 Unit location ID Nun	Q1 ID Num	Q34 Rate donning/doffing	Q35 Rate ICS clarity	Q36 Rate ge (Male)	Q36 Rate gender clarity (Male) (Female)	Q37 Rate overall speech clarity	Q38 Rate noise reduction	Q39 Rate warning signals	Q40 Rate monitoring A/C noises	Q41 Rate weapons fire
2.	3	3	7	9	٠	4	,	,	,	
	4	4	7	· vc	, ,	, ,	٧ -	,	n ×	Λ,
	S	4	7	, ,			o vo	- 4	4 C	4 (
	9	4	7	ی ر	· vo		, ,	o 1	7 6	۰ ،
	7	4	7		۰ ۲		- 4	~ vc	n 4	۰ ح
	∞	-	7	7	7	7		î	۰ ۷	t r
	6	4	7	7	7	7	, ଏ	7) v o	
	10	2	7	7	7	7	8	pend	4	· 100
	11	ю	7	1.	7	7	7	7	7	
	12	4	7	7	7	7	9	7	. 10	
-	13	9	9	9	9	9	9	9	, ivo	o ve
	14	2	7	4	4	7	7	7	. 7	9
	15	3	7	7	9	7	4	7		٠ ٧٠
	16	4	7	7	7	7	4	7	4	, 4
	17	4	9	9	9	9	9	7	9	٠ ٧٠
	18	Э	7	7	7	7	7	7	4	, vc
	19	3	9	7	7	7	4	4	4	י עי
	20	4	7	7	7	7	4	. 7	9	4
. .										
	,	4	7	7	7	7	7	4	9	7
	7		7	1.	7	7	7	7	4	٠,
	33	4	7	7	7	7	7	7	7	, ,
	4	9	7	7	7	7	7	7	7	, ,
	2	7	7	7	9	7	7	7	7	
	9	4	7	7	7	7	7	7	7	
	7	3	7	7		7	4	7	4	- 4

Q1 Unit location ID	Q1 Num Num	Q1 Q34 ID Rate Num donning/doffing	Q35 Rate ICS clarity	Q36 Rate gei (Male)	Q36 Rate gender clarity (Male) (Female)	Q37 Rate overall speech clarity	Q38 Rate noise reduction	Q39 Rate warning signals	Q40 Rate monitoring A/C noises	Q41 Rate weapons fire
3.	•	4	9	9	9	9	5	. 4	4	4
	6	4	9	9	9	9	9		• • •	7
	10	4	7	7	7	7	9	7	ĸ	• •
	=	4	7	7	7	7	4	7	4	4
	12	7	9	9	9	9	9	9	4	9
	13	60	7	7	7	7	9	9	က	S
	14	4	7	7	7	7	4	7	m	4
	15	4	7	9	9	9	4	4	4	4
	16	33	8	5	S	٧٢	4		4	4
	17	4	4	4	4	4	4	_	4	
4.										
	_	æ	7	9	9	9	9	7	9	9
	7	7	7	7	7	7	7	7	S	e
	Э	1	7	7	7	7	7	7	9	9
	4	-	4	4	4	4	4	4	4	4
	S	9	7	5	S	v	9	9	9	9
	9	2	\$				ď	5	4	3
	7	3	7	7	7	7	7	7	7	7
	∞	\$	7	7.	7	7	7	7	5	\$
	6	4	7	7	7	7	7	7	7	7
5.										
	_		7	7	7	7	က	7	3	
	7	4	٧٠	\$	ď	5	S	7	vs	\$
	33	9	7	7	7	7	7	7	85	
	4	9	7	7	7	7	7	7	7	9
	S	e	7	7	7	7	7	7	3	

Q1 Q1 Unit location ID		Q34 Rate donning/doffing	Q35 Rate ICS clarity	Q36 Rate ger (Male)	Q36 Rate gender clarity (Male) (Female)	Q37 Rate overall speech clarity	Q38 Rate noise reduction	Q39 Rate warning signals	Q40 Rate monitoring A/C noises	Q41 Rate weapons fire
5.	9	3	7	4	4	y	,	r		•
	7	*^	7			o 1	9 7	- (4	4
	00	4				- 1	- (7	7
	6	· m			- 1	- 1	, م	7 -	9	9
	10	4		. v	- '		v) ×	- 1	4	4
	Ξ	4	7	,	>		† †	- (7	٠ ک
	12		7	7	7			~ 4	·	so v
	13	4	7	7	7	7	- 4		7 -	o
	14	4	9	9	. 49	. 40	۰ ۷	۰ ۷	4 ~	
	15	9	7	7	7	, ,	. 4	o 6	†	
	16	3	7	7		•		· -	† -	
6.							•	-	1	
	-	5	9	9	9	9	ν.	v	¥	•
	7		9	9	9	9	, ,		.	o t
	က	4	7	7	7	7	- 4		, , r	•
	4	2	7	7	7	7	7	· vo		† ¬
	2	4	7	7	7	7	7			† 6
	9	4	7	7	7	7	3	. 1	۰ ۳	۰ ،
	7	7	7	7	7	7	7			4 F
	∞	4	7	7	7	7	4		۰, ۳	~ v
	6	4	7	9	7	7	9	· va	a vo	n v
t	10	wind		-	_	1	-	. =	, v	·
.,	-	•	ı							
	٠,	4	,	7	7	7	7	7	7	7
	7	m	7	7	7	7	4	7	7	۳.
	m	33	7	7	7	7	9	7	4	, v o

Q1 Q1 Unit location ID	Q UM Mum	Q1 Q34 ID Rate Num donning/doffing	Q35 Rate ICS clarity	Q36 Rate ge (Male)	936 Rate gender clarity (Male) (Female)	Q37 Rate overall speech clarity	Q38 Rate noise reduction	Q39 Rate warning signals	Q40 Rate monitoring A/C noises	Q41 Rate weapons fire
7.	4	3	9	9	9	9	2	4	4	2
	S	9	7	7	7	7	7	7	9	9
	9	4	7	7	7	7	3	7	7	4
	7	m	9	9	9	9	9	7	9	9
	∞	7	7	9	9	7	7	7		7
	6	4	9	9	9	9	4	9	4	S
	10	4	7	7	4	7	7	7	7	7
	Ξ	7	7	7	7	7	7	7	7	4
	12	7	7	7	7	7	7	7	4	4
	13	4	7	7	7	7	4	7	4	9
	14	9	7	4	4	7	9	7	9	9
	15		7	7	7	7	7	7	33	9
	16	4	7	7	7	7	s	7	s,	4
	17	S	S	2	4	S	S	\$	'n	\$
	81	4	ۍ	\$	S	S	5	S	4	5
	19	2	7	7	9	7	9	7	ю	9
	20	4	7	7	7	7	7	7	ю	7
	71	4	7	7	7	7	7	7	2	7
	22	7	7	9	9	9	4	4	4	4
	23	4	7	7	7	7	7	7	7	9
œ.										
	-	4	7	7	9	7	7	7	4	7
	7	9	7	9.	9	7	7	9	7	2
	æ	3	9	9	9	9	4	9	s	4
	4	7	7	9	9	7	7	9	m	4
	8	ĸ	7	7	7	7	7	7	3	9

Q1 Q1 Unit location ID Nur	_	Q34 Rate donning/doffing	Q35 Rate ICS clarity	Q36 Rate ger (Male)	236 Rate gender clarity (Male) (Female)	Q37 Rate overall speech clarity	Q38 Rate noise reduction	Q39 Rate warning signals	Q40 Rate monitoring A/C noises	Q41 Rate weapons fire
∞i	4		v		,	,	,			
	, ,	good	·	t	+	4	4			
	∞	3	7	7	7	7	ю	4	.	"
	6	3	۶.	S	٠	S	· v		s en	, v
•	10	2	7	7	7	7	4		, 4 1	'n
	11	4	7	9	9	9	7	ო	· 100	7
	12	4	7	7	7	7	æ	7	4	- 4
	13	3	7	7		7	7	7	4	
	14	7	7	7	7	7	7	7	7	. 4
	15	3	4	4	4	4	4	4	4	. 4
	16	7	9	9	9	9	en	7	4	. 4
	17	2	5	S	4	S	S	4	· •⁄	- 4
6									•	•
	_	S	7	9	9	7	9	S.	v	
	7	4	7	7	7	7	7	7	, ,	7
	e	3	7	7	7	7	S	5	4	,
	4	7	7	7	7	7	9	9	• • •	,
	S	9	7	9	9	7	7	7	7	7
	9	4	9	9		9	4	9	m	
	7	3	7	S	S	\$	9	9	9	9
	∞	4	7	7	7	7	7	7	7	7
	6	3	7	7	4	9	9		9	
	01	4	5	ď	\$	5	v	5	4	9
	=	Э	4	4	4	4	4	4	4	
	12	3	7	4	4	7	7	7	4	4
	13	3	7	4	4	7	7	7	3	4

Q1 Unit locatio	o1 Num	Q1 Q34 Q35 Unit location ID Rate Rate ICS Num donning/doffing clarity	Q35 Rate ICS clarity	Q36 Rate go (Male)	Q37 Rate gender clarity Rate overall (Male) (Female) speech clarit	Q37 Rate overall speech clarity	Q38 Rate noise reduction	Q39 Rate warning signals	Q40 Rate monitoring A/C noises	Q41 Rate weapons fire
6	14	4	9	9	6	9	. A	9	3	9
10.	16					7	• •	9	m	
	-		7	7		7	9		4	\$
Overall Total N = 152 M = SD = SD = NR = NR =	N = 15	3.7 1.3 12	M = 6.6 SD = 1.0 NR = 0	M = 6.3 SD = 1.1 NR = 3	6.2 1.1 9	M = 6.5 SD = 0.9 NR = 3	M = 5.6 SD = 1.5 NR = 1	M = 6.2 SD = 1.4 NR = 6	M= 4.7 SD= 1.5 NR= 5	M = 5.3 SD = 1.4 NR = 17

Q1 Unit location 1.	Q1 ID Num 1 2 2 3 4 4 6 6	Adverse effects of CEP 0 0 0 0 0 1 They are too fragile. I love the CEP. They take a little extra time to install but the benefits are worth it.	Problems encountered while wearing CEP Problems encountered while wearing CEP Poor construction of CEP. The CEP needs to be more durable. Sometimes. Hot spots will develop inside the ear canal if plugs are inserted too far in. See above The cord catches on things and will dislodge from the ear. It is very difficult to install them in-flight. The only problem I have with the CEPs is that over time, extended mission over 2 hours, the CEPs tend to slop out of your ears. Also the center post tends to dig into your inner ear over long missions witch makes them uncomfortable.
	9 10 11 12 13 14 13 13 13 13 13 13 13 13 13 13 13 13 13	0 0 1 They are not built to handle serious wear and tear. 0 1 They are too fragile. Mine broke after roughly 25-30 hours of use and my ALSE technician was not trained or probably equipped to repair the items 0 1 easy to lose 0	Once the wires are strengthened the device will be better No problems During extended periods of wearing the CEPs they make the ear canal ache. Sore ear canals Continuous use (4 days in a row of 4-hour flights each day) results in ear canal sensitivity

Q1 Unit location	Q1 ID Num	Q42 Adverse effects of CEP	Q43 Problems encountered while wearing CEP
.i	23	0	
7	-	0 It blocks out all aircraft noise.	I think the more durable parts are the way to go when making this final CEP because they go thru alot in the field and we need an inexpensive, more durable unit to provide to pilots to improve communications between aircrews ground elements. ATC & Commendant
	3 2		Very delicate.
	, 4	0	Make the foam stiffer.
	so v	0	In reference to monitoring noise generated by the aircraft, blocks out A/C noise and you can't hear engine and rotor noise.
	۷ 0	0 1 Foam tips fall apart after second wash and cannot stay compressed to insert in	Foam tins not durable after first wash
	∞ (0	The Velcro on the left wire will drive you nuts when it falls off the Velcro in the back of your helmet. The threaded stud needs to be flexible so as to conform to the inner ear canal.
	e 01	 Caution/ warning tones were too loud. I am used to yellow foam earplugs while flying - caution tones just right 	
	=	0	Wires getting caught on other items strapped to my head or body. I have had CEPs for close to a year with no foam replacement. Mine are no good.
	12	1 The only problem that I have, is that they are made to flimsy. They need to be hardened some way. As I said, I'm on my third pair	Mine have broken right at the ear foam, where the wire connects to the foam
	13	0	Long wire caught on vest and pulled CEP out of ear. While trying to adjust this the wire broke
	14	1 CEP offers better hearing of radio traffic. A wider range of ear plug portions and stronger cord connection to plug screw portion would greatly increase the lifetime of these plugs. Aviators are very rough on equipment. Build them to	
	15 16 17	0	

Q1 Unit location	QI Olum Num	Q42 Adverse effects of CEP	Q43 Problems encountered while wearing CEP
2.	18 19 20	0 They broke within 75 hours, very uncomfortable. Maybe I was sized wrong.	Wires easily caught on objects and pulled out of ears. When foam tips are hot and moist they will not stay collapsed long enough to insert into ear Broke less than 75 hours and not comfortable
ઌ ૽	3 2 -	0 1 Stem failure - earplug stuck in ear during flight 0	See above There is a need for ICS performance. The CEP is a good interim fix, but it is fragile and easy to lose. It takes extra time to don helmet especially when using NVGs.
	4 % %	0 0 1 Cautions/warnings too loud 0 Not a big problem but just one more thing to add to a long list of small	I've gotten spoiled and hate flying without them
	9 10 11 12 12		They are not very durable overall Tones are too loud Advisories too loud Doesn't stay in my ear well
	13 14 15 16	0 0 0 adjust the ICS to hear radios and cockpit communication, the aircraft caution and warning audio becomes entirely too loud.	Ear piece wires seem way to flimsy-they break at ear piece commonly. I was very careful not to put undo pressure/stress on system, and after 100 hours of flying, one wire reached it's useful life and broke at ear piece.

Q1	10	Q42	Q43
Unit location	ID Num	Adverse effects of CEP	Problems encountered while wearing CEP
4.			
		1 Discussed it in earlier questions.	It slides out too easily. Need smaller but more snug earplugs.
	7	0	
	3	0	
	4	1 They are uncomfortable	
	\$	0	
	9	0	The foam changed after washing. It no longer holds its reduced size to
	7	0	
	∞	0	
	6	0	They fall out.
5.			
		0	
	7	0	
	e	0	Difficulty getting them to stay in ear canal and some ear canal pain because of pushing them in hard so they will stay in when donning helmet.
	4	0	The speaker end of the wires would be more comfortable if they were smaller, or if they were formed and fitted for each ear.
	5	0	Some ear pain is associated with the insert but will change to a smaller size when available.
	9	0	
	7	 The installation portion. Soldering wires together makes weak wires and eventually will break. 	See #12
	•	. 0	No problems
	6	0	
	10	0	No problems encountered so far.
	11	0	
	12	1 During engine start I cannot hear the igniters pop or hear the engine light off.	
	13	0	Snags when putting the helmet on and taking it off.
	14	0	

Q1 Unit location	Q1 ID Num	Q42 Adverse effects of CEP	Q43 Problems encountered while wearing CEP
ં	15	0	
نو	16	_	CEP make caution/warning signals way to loud.
;	-	-	The CEPs were not made durable enough for ARMY aviation. The wires, the tips, and the harness assemblies have all had major failures within the first 3
			monuls. Some tips broke on initial issue to the user, causing what I think should be a QDR issue.
	7 ,	0 (
	η 4		The warnings are extremely loud but that is not a CEP problem.
	8	0	
	9	0	
	7	0	
	oo	0	Wire laying on outer ear causes hot spots, wire is too long and gets caught
	6	0	The only problems I had were noted on the cover sheet (1 and 3). Wire
	10	1 Can't hear as well.	breakage at transducer and screw tip breaking off. They pull out when donning, extremely uncomfortable, can't hear as well,
7.			does not reduce noise as well.
	-	0	
	7	 Only that the CEPs would sometime operated intermittently, but nothing significantly 	
	e	0	The only problem I have is the wore getting caught and pulling on the earnluss when I turn my head
	4		
	2	0	
	9	0	
	7	 Aircraft audio tones extremely loud. 	
	∞	0	The problems I have encountered you have already addressed.

Q1 Unit location	Q1 ID Num	Q42 Adverse effects of CEP	Q43 Problems encountered while wearing CEP
7.			
	6	. 0	Problem getting the right size foams.
	10	0	
	=	0	Wire pulls CEP out of ear.
	12	0	All problems were addressed in the questionnaire.
	13	0	I had a wire break at the CEP when removing my helmet. I really like them.
	14	1 The wire harness is difficult to lay around the ear properly. It will cause some minor discomfort if harness is not properly routed around the ear.	The wires tend to snag on harnesses and connector within the cockpit.
	15	0	
	91	0	Forgetting to unhook before doffing.
	17		Don't use. Don't like it.
	18	0	Better quality
	19	. 0	
	70	0	Slight discomfort after 3-4 hour flights. Ears get a bruised feeling
	12	C	Occasionally.
	: 23	0	Only productions are sugar not spot internation in (20).
	23	0	
%			
	-	0	Availability of parts-we do not have enough helmets or CEPs. Sometimes the wires can get over my ear and between earning and annual discounting
	7	0	are miss our for over my our miss occurred caredps and cause disconnect.
	3	0	None that have not been discussed earlier.
	4	0	
	'n	0	The foam inserts in the helmet push on the CEP ear plugs which cause ear
			pain.
	9		
	7		
	∞	0	No major problems.

Q1 Unit location	QI Num	Q42 Adverse effects of CEP	Q43 Problems encountered while wearing CEP
တ်	6	0	My left ear canal is now tender from everyday use, resulting in just placing
	10	I Caution warning and advisory signals are always full volume. I do not wear CEPs during contact training for this reason.	ute CET device from first ear for flow. If the ear piece were smaller, it would be more comfortable. If the foam plugs were more firmer, they would be easier to insert.
	11	0 I Caution and warning tones cannot be turned down and are too loud for use with	Foam inserts do not last very long. Wires are arone to beaulogs at the
			र जन्मा महत्वस्य देव महत्त्वस्य स्तु न जाहि समाध्य कर माणाह । जारवस्यष्ट्रहें वा पाह
	13	0	I cannot use the foam earplug without significant modifications. I always had to use the rubber triple flange earplugs, due to problems fitting the foam ones. The foam ones wear out too fast and nose a problem in replacement
	14	0	the state of the s
	15	1 Overall clarity/noise reduction was not improved only amplified. The CEP does not correct deficiencies in the OH-58D ICS system.	I do not like wearing earplugs so my opinion is biased.
	91	1 It takes some time to get used to. Its not as easy as just putting on a helmet. However after it is used for a while you get used to donning and doffing procedure and the sequence you must go through to get it on.	Mild pain in the ear canals after 2 hour flights. Donning procedure requires a sequence that must be followed or CEP will be pulled out. Basically the CEP must he donned just prior to helmet use
	11		
٠,			
	(0	Have not worn CEP long enough.
	7 (
	n	Þ	Wax in the plug canal, broken wire right plug, uncomfortable after a period of time.
	4	0	
	S	. 0	
	9	. 0	
	7	0	With doors off aircraft has significant noise.
	∞	0	
	6	0	CWA too foud!
	10	0	
	=======================================	0	

Q1 Unit location	Q1 1 ID Num	Q42 Adverse effects of CEP	Q43 Problems encountered while wearing CEP
9.	2	•	7 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 -
	71		Donning the neimer with CEP can't be done with Hight gloves on.
	13	0	
	14	0	
	15	0	
	91	0	
10.			
	-	0	With all noise/radio/ICS levels in a comfortable range a CWA message/tone in an OH-58D is extremely loud and annoying.
Overall Total N = 152		Yes 27	

Q1 Unit location	Q1 DNum	Q44 General comments about CEP	Q45 Rate overall value of CEP
1.	1	The need to be more accessible and should be fielded to all helicopter pilots	7
	7	Great! Use to wear earplugs occasionally resulting in hearing difficulty in the cockpit. I wear CEPs all the time now. I hear perfectly and I am also protected from outside noises.	7
	æ	Good noise attenuation during gunnery but needs to be a little more durable.	'n
	4	No big problems yet. Haven't flown with them much yet.	v o
	ĸ	The benefits greatly outweigh the time and difficulty putting them on.	7
	9	Very nice increase in hearing ability of ICS, radios. The caution/warning tones are excessively loud now.	
·	7	Overall CEPs are a valuable asset. They only have a few minor problems but overall they improve our ability to accomplish out mission.	7
	∞	I would rather the original problem be fixed instead of giving me another piece of equipment. Fix the ICS problem and throw out your temporary fix. While you are at it give me a helmet with active noise cancellation. The computer in the aircraft will tell me of any problems prior to me hearing any change in engine noise anyway.	
	6	They are great - you just really need to take care of them.	7

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
.:	10	Slightly better hearing protection, slightly better quality audio. Benefits aren't really worth the hassle of use. Plugs leave ear canals feeling they have been bored out with a cleaning brush.	. 6
	=		7
	12	Need to be more rugged	٢
	13		vo
	41	Bulk of the transducer	7
	15	They significantly increase the clarity of radio traffic	r
	16	EXCELLENT! Need to field all units, back fill others. This has improved crew safety and communications immeasurably	7
	17	ICS is definitely better, however the fragility of the systems lends itself to breaking	m
·	8		7
	19	Definitely needed device. Just come up with a better design.	7

Q1 Unit location	Q1 Num Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
.1	20	This is one of the Army's best ideas. The radios in the OH-58D(I) are hard to hear without the CEPs. The CEPs help dramatically in the ability to hear and comprehend the radio traffic. You don't have to focus all your attention on the radios with the CEPs in. This is a great product.	7
	21	We absolutely need them! They could be a little louder	٢
	22	The entire Army should have them	7
	23		v
.	-	The CEP is long overdue. Excellent!! My first CEP broke but I was able to acquire another by someone leaving and I have taken better care of it.	7
	2	Excellent	7
	e	I think there is a world of difference with the CEP. Noise is reduced and clarity over the radio is so much better.	9
	4	Getting to the point of too many wires on the head: helmet, ODA, goggles and neck strap, CEP and lip light.	7
	٠ς	Other than the wire getting caught on the vest and other equipment, I thought the CEPs were a great improvement over just the helmet. I couldn't wear yellow ear plugs because I could not hear at all. This is a great improvement.	7

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
7	9	Much easier hearing crew members as well as the radios.	7
	7	Great product. Continue to improve and field to everyone.	7
	œ	I used to wear yellow foam earplugs all the time. Once I started using CEPs I got addicted to being able to understand the radios. But they are so painful after prolonged periods that now I don't use any additional hearing protection. But I still don't use them except for gunnery.	ĸ
	6	Commo is much more easily understood while using CEPs, however if you use CEPs for 50 more hours and then revert back to yellow earplugs, you can have almost nothing!	٢
	10	Significantly improved cockpit communication	٢
	=	Great device but need more replacement foam inserts!	
	12	I like them a lot. The difference between not wearing them and wearing them is night and day.	7
	13	Foamy does a good job with noise levels. It is a pain in the ass by getting caught where vest and collar meet. It would pull the CEP slightly from the ear. Plus the CEP is cheaply built. The cost is extremely high.	9
	4		9

Q1 Unit location	₽ 8	Q44 General comments about CEP	Q45
	Num		value of CEP
7.	15	After using CEPs exclusively and then having them break, I had to go back to yellow ear plugs with great reduction in hearing performance. I had gotten very used to being able to hear communications clearer.	9
	16	CEPs are great! I was really upset when mine broke. Can't wait to get another pair.	7
	17		9
	18	Good item if wires and foam tips are improved. Use same material as yellow foam earplugs?!	7
	19	Though not comfortable, I could definitely hear all radios and ICS better	
	20	I hope I never have to go back to flying w/out CEPs or something like them. The benefits far exceed the discomfort I have to put up with. If they were made more comfortable they would be better yet.	7
ë.	-		7
	2	I like it. Need more durable product	,
	e	Sometimes it gets hung up when turning head which could distract pilots at critical times during flight. It enhances mission performance when you can actually head what is being transmitted over the ICS and radios	7

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
3.	4	A/C needs voice activated ICS due to work load and the need for cockpit communications.	7
	٧٠	The CEP works great but it is a bit too fragile the wires are too weak and the location needs to be moved	7
	9	It has been a pleasure, especially when flying from the right seat. It has added a significantly wider volume range. I can tum a radio volume knob all the way down and still adequately hear and understand speech on that radio. I never advocate crewmembers pulling their ICS pins, and do not have to when utilizing the CEP. It makes flying with doors off much more pleasurable.	L
	7	Viable product. I endorse it	7
	∞	These earplugs seem to me a bandaid over the larger problem. Rather than investing any more money, time or equipment on these earplugs how about putting some better ICS boxes in the aircraft. The aircraft at FT Rucker had VOX boxes in the aircraft. Those boxes were more than adequate. I used both my SPH-4B and HGU-56 with earplugs with the VOX box and had plenty of volume in all flight modes.	2
•	6	After getting used to them I have found them to be an outstanding product	9
	10		7
	=	Love them!	7
	12	Works well can hear radios well reduces aircraft noise	9

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
3.	13	Great. Help hearing co-pilot over noise of aircraft/radios. I would consider this essential to good cockpit crew co-ordination and communication. This is common to everyone I know who uses these plug phones. Also, Also,	7
	41	Excellent product!! I do not think I could fly without it now.	7
	15		*0
	91	Due to the task load of the CPO in the OH-58D, the CPO must use "hot mic" on the ICS. This degrades the level of audio clarity. This aircraft must have "voice activated" (VOX) ICS, as a minimum at the CPO station. This will greatly improve the communication clarity of the aircraft. I have used these at Ft rucker and was well pleased with them.	7
	11		
4,	-	The communications clarity is excellent - the improvement is worthwhile. We need just minor fixes.	9
	7	I love them. Try to improve.	7
	8	Even with the added time and some discomfort, the CEPs are far superior to the older helmets.	
	4	Don't like it.	-

Q1 Unit location	Q1 UD Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
4	S	Overall it is a good system but it needs to have a more durable wire and connection. Must be a stronger wire.	9
	9	It looks goofy with the large ear cuffs.	s
	7	I like the CEP much better then the old SPH-4 but the shape leaves a little to be desired. The SPH-4 was a better looking helmet.	7
	œ		9
	6		٢
κ,	-	CEPs work well in clarifying speech and being able to communicate in the cockpit.	
	7		85
	æ	Extend the length of the helmet chin strap to ease helmet donning with earplugs installed and shorten slightly the length of the tube inside the foam on the plug itself to ease ear canal pain. The CEP has greatly increased the safety of flight in the OH-58D. Do not take it away. I can hear the radios and my co-pilot at all time now.	٢
	4		7

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
5.	s.	They are awesome! The ability to hear everything is so much better with these CEPs I can live with a little discomfort. The safety benefit of being able to hear the other pilot is also a giant plus. Doors off flying is so much better now.	٢
	9	Just purchase the BOSE headsets and put them into our helmets, it's a superior proven product. Good idea but poor design! Too cumbersome when doing exercises. Cannot put helmet on and go. You are required to "fiddle with it"	'n
	7	Makes a big difference in hearing radios and internal communications.	
	00	The ARMY has finally purchased a piece of equipment that not only is functional, but doesn't burden the soldier with its use. Thanks!	L
	6		7
	10	The CEP has improved the ICS systems clarity and radio clarity 100%. Especially with doors off. I think the CEP is a good improvement for OH-58D pilots.	7
		An excellent system that improves ICS communication and reduction in noise. I would not want to fly without the CEP after flying with it.	7
	12		7

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
5.	13	All ICS and radio communications is significantly better. Crew coordination is better - radio management is much easier since the pilot doesn't have to have all radios turned all the way up in order to hear anything. The number of "say again" and "what did you say" have significantly decreased.	7
	. 41		9
	15		7
	16	Correct piece of equipment.	7
•	·	Reorder problem- PCS of pilots caused severe shortage of CEPs available to new arrivals. CIF was making ALSE turn in the helmets as a complete kit with CEP installed. Can't get thru normal supply but as GSA item causing problem due to lack of funds. Once I punch a hole thru the back of the earcup black plastic liner, that condemns the helmet for turn-in procedures - again causing a reorder problem for the ALSE maintainers. I would like to see an improved earnhone assembly, such as the BOSE system in the HGII-56/P instead of an additional item to be	v
	7	maintained, taught, installed, and stocked. 60% of the original pilots have gone and new pilots do not have CEPs I like it. It works well.	,
	ю	I would like a more durable and sturdy product. I am always afraid of breaking them.	9

Q1 Unit location	Q1 Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
.9	5	Great system. Just make wiring system more durable (most pilots wash their earplugs with flight suit).	7
	9	Very, very fragile.	9
	,	They are great but break easily.	7
	∞	Greatly improves volume levels in the OH-58D, sometimes the FM radios are impossible to hear without CEP.	9
	6	Great idea but poor design in durability.	7
	10	Very little. I don't like it.	-
7.	-		7
	2	I think it's a great product or piece of equipment that is very much needed for the OH-58D(I)	7
	E	Although there are some minor problems with the CEP, it has significantly enhanced my ability to communicate within the cockpit and over the radios. I have absolutely no desire to give up my CEP and go back to my old helmet system	7

Q1 Unit location	QI Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
7.	4	It would have been nice to have an ICS setup so one would not need a CEP. I still have a difficult time understanding what is said because of the static.	5
	s.		7
	9	I do not want to fly without my CEP. Since wearing the CEP I can now hear everything in the cockpit. My overall rating for the CEP is excellent.	
	7		9
	∞	Very good device.	7
	6	I like them	7
	10		7
	Ξ	Outstanding, even with the minor problems.	7
	12	Great addition to aviation flight aids even with the minor problems. We need this device.	7

Q1 Unit location	Q1 D3 Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
7.	13	I refuse to fly without them. It makes the job much easier. It's really obvious when flying with a pilot w/o the CEPs. I'll understand a radio message while the other pilot is saying "say again".	7
	14	It is a great idea! I use the CEP always. If the speaker was smaller and the wire stronger it would be a better product. Also the foam plug portion would be better if it held its form when compressed like yellow foam plugs do.	7
	15	Great system, however the wire keeps breaking from the ear plug.	7
	16	Drastic improvement over using foam ear plugs. Clear communications. You don't have to turn radios up full blast. The word is a hassle and time consuming but I still wouldn't be caught without my earplugs. Suggestion: make two connectors, one in each earcup. This will eliminate the cord catching on seatbelt and goggles.	7
	11		4
	18		ĸ
	61	Great idea - Needs a better design. We already have up to 3 wires hanging off our helmets. Adding another wire with the CEP does not help things.	vo
	20	I like them! Make the plastic tube a bit shorter and more flexible.	
	21	Really improves the ability to keep out outside noise from the aircraft.	

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
7.	22	They make hearing great. So much better than flying with earplugs but they are a hassle to put on. I only used them on real mission and just tolerated the lack of being able to hear the rest of the time. Bell needs to fix the aircraft so we can hear. CEPs need to be more comfortable like the ones the NASCAR drivers use.	8
	23	These have completely revolutionized aviation. It is terrific. The ability to hear everything is a critical part of aero-scouting and this has enhanced it greatly. I love them and I pity anyone without them.	<i>L</i>
ø.	-	Alignment of goggles, they don't always align with my eyes, if we could get dual adjusting goggles - this would solve that	7
	7	I like the system, but the problem I have found is if I use plain foam earplugs, I cannot hear the ICS as well. If I wear the CEP everything sounds fine. Another concern of mine is that I hear a lot more acft noise wearing the HGU-56 and CEP system.	vs
	ю	Improves the internal and external communications. Allows me to monitor not only the radios but also copilot/student communication.	90
	4.	Good idea, ergonomically not the best product.	vo
	'n	Great system.	vo
	9	Do not use.	

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
∞	7		
	∞	I like them. They improve hearing significantly!	7
	6	Great device. You may not have it back.	ĸ
	10	Worthwhile.	9
	Ξ	Concerned about lack of maintenance or replacement. I will be seriously disappointed when my CEPs are no longer serviceable and there will be no replacement.	
	12	Good compromise/ low cost alternative to actually fixing the OH-58D ICS system.	7
	13	I would like to see rubber styles. They would last longer and fit easier. I love the increased audio clarity of the CEP, and I feel it is a must in the OH058D. However, it breaks too easy and the foam sizes are too restrictive and wear out too fast.	v
	14	Great addition especially in the OH-58D (I) Kiowa Warrior.	٢
	15	I have had experience flying/testing with an Active Noise Reduction system. I prefer that system because it removed or reduced unwanted noise.	ю

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
œ́	16	Aviation is a noisy environment so most people wear earplugs on the flightline during pre-flight, etc. and this requires removing one set of plugs and replacing them with others. I like being able to hear, but the donning/doffing procedure stinks. It pulls out a lot which I can't stand. After a while you rig it so this doesn't occur. A lot of people do not use it for this reason.	٠,
	17	But in the end when all on correctly - hearing is great!! It does reduce noise level but it is more of a pain to maintain and use in a time critical environment.	ю
6	-		vo
	2	This is the absolute best thing that R&D has added to the aircraft-Pilot interface I have seen. I can hear everything I need to without sacrificing my inner ear. The safety margin has been greatly increased now that ICS is clear and concise. Radio traffic is easily monitored. It is worth the slight amount of discomfort. I would personally buy my own set if not issued.	٢
	ю	Overall much better.	7
	4	Best thing to come along for 58D's, increases ability to hear everything.	7
	٧	The speaker assembly should be smaller so it doesn't rub on the ear cup foam. The size of it causes extra pressure on ear canals. Suggest a molded type ear plug such as those used with race car helmets.	٢
	9	I like the system despite the added steps. I can now actually turn down the volume on the ICS control.	9

Q1 Unit location	Q1 UN Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
6	7		9
	∞	Improvement.	7
	6		9
	10		'n
	11		v
	12	Why didn't somebody think of this before?	7
	13	Infinitely better.	7
	14		•
	15	Generally do not like HGU-56. Poorly engineered. Should not have to have modification.	
	16		۲.

Q45 Rate overall value of CEP	7	Mean = 6.3 SD = 1.3 NR = 5
Q1 Q44 ID General comments about CEP Num	Love them! Keep improving them and get them in the supply system immediately. One just must figure out which order to put on the equipment, goggles, CEP, helmet	
Q1 ID Num	1	N= 152
Q1 Unit location	10.	Overall total

Reference

Murphy, B.A., and Mozo, B.T. 1999. <u>Flight Evaluation of the Communications Earplug</u> (CEP) in the OH-58D Helicopter. (Part 1) Fort Rucker, AL: U.S. Army Aeromedical Research Laboratory. USAARL Report No. 2000-04

Appendix.

EVALUATION OF THE COMMUNICATIONS EARPLUG IN THE OH-58D HELICOPTER ENVIRONMENT

INSTRUCTIONS: You have been asked to wear the Communications Earplug (CEP) in conjunction with your aviator helmet during your daily mission to evaluate its operational effectiveness and comfort. Please complete the following questionnaire. Most questions are self-explanatory with room for comment. Please try to be as precise as possible when making your comments. Some questions will require you to mark on a continuum between extremes. Your responses should be indicative of the strength of your feelings. Note: Please bear in mind that all comparison questions are between the helmet you normally used in the past and the CEP.

Personal data:
1. Unit location:
2. Today's date:
3. Sex:MF
4. Experience as an aviator: years. Approx. No. flight hours:
5. No. flight hours wearing HGU-56/P helmet (prior to CEP installation):
6. No. flight hours wearing CEP: Is the CEP still functioning properly?Yes No If no, describe the malfunction
7. CEP foam tip size: StandardSlimShortCombination
8. Seat position during most flights:
9. Do you have a waiver or information only letter (IO) for a hearing loss? YesNoNot Sure If Yes, how long have you been on waiver?
10. Do you normally wear eyeglasses when flying?YesNo If Yes, what type temples are on the glasses you normally wear?(examples: bayonet temples, wire frames etc
Personal Hearing Protection:
11. Prior to CEP installation, did you wear earplugs in conjunction with your flight helmet? YesNo If No, skip next question.
12. Did you frequently experience discomfort with your earplugs?YesNo If Yes, how long does it take before you feel the discomfort Describe the discomfort (example: itchiness, pain etc)
13. Prior to CEP installation, did you frequently experience discomfort with your helmet while flying? Yes No If Yes, how long does it take before you feel the discomfort? Describe the discomfort (examples: hot spots, headache etc.)

-		
и	m	na:
T. I	··	ug.

14. Have you experienced any difficulty in fitting the CEP?YesNo If Yes, please explain	
•	
15. Was there any discomfort when inserting the earplug?YesNo If Yes, please explain	
16. Do the wires pull on the CEP when turning your head?YesNo If Yes, please explain	
17. Does the CEP move or slip out of the ear during flight?YesNo If Yes, please explain	
18. Wire lengths of the CEP: SHORT wire wastoo shorttoo longjust right. LONG wire wastoo shorttoo longjust right.	
19. Were there any problems associated with CEP during night flights?YesNo	
20. Does the CEP catch on other equipment or interfere with job performance?YesNo If Yes, please explain	
21. Is the orientation or location of the connector convenient?YesNo If No, where would be your preference on the helmet	
22. After how many flight hours did you clean or change foam tips?	
23. How did you clean foam tips?	
24. Was there a problem of wax build-up in the CEP foam tip?YesNo	
Comfort:	
25. Does the CEP cause any discomfort in your ear canals (itching, pain etc)?YesNo If Yes, was it ::	
Mildly Moderately Extremely uncomfortable uncomfortable uncomfortable	
26. Does the CEP cause any discomfort to your external ear?YesNo If Yes, please describe	
27. Are there any hot spots associated with CEP?YesNo If Yes, please explain	_

	1/2 hr	1 hr 1-1/2 hr	s 2 hrs	2-1/2 hrs	3 hrs	3-1/2 hrs	s 4 hrs	
9.	With respect to ov	erall fit and comf	ort, compare	e the CEP de	vice with	ı your pe	rsonal helmet.	•
	Significantly Better	Moderately Better	Slightly Better	Same		lightly /orse	Moderately Worse	Significantly Worse
or	ning and Doffing	:						
0.	Does the additionYesNo	of the CEP result If Yes, please of				~ ·		
1.	Does this extra ste			in completing				
2.	Do you have probl If Yes, please			with gloves		_Yes	_No	
4.	when the CEF If Yes, please With respect to do		***					
	Significantly Better	::_ Moderately Better	Slightly Better	:Same		ightly orse	Moderately Worse	Significantly Worse
5 .	Rate the difference helmet.	in <u>ICS</u> speech cl	arity/unders	tanding when	n compai	red to yo	ur personal	
	Significantly Better	Moderately Better	Slightly Better	Same		ightly orse	Moderately Worse	Significantly Worse
6.	Rate the difference to your person				nel base	d on geno	ler of the talke	r when compare
				Male Voice				
	Significantly Better	Moderately Better	Slightly Better	Same		ightly orse	Moderately Worse	Significantly Worse
			F	emale Voice	e			
	Significantly Better		Slightly Better	Same		ightly orse	Moderately Worse	Significantly Worse

37.	Rate the differ helmet.	the difference in <u>overall</u> speech clarity/understanding when compared to your personal helmet.					
	Significan Better	Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantl Worse
Noi	se Reduction/A	Attenuation:					
38.	With respect to	reducing noise level	s at your ears,	compare the	CEP to your	personal helme	t.
	Significan Better	tly Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse
39.		o allowing you to hear ur personal helmet.	navigational	and caution/	warning signa	ls, compare the	, •
	Significan Better	tly Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse
40.		your ability to hear a rsonal helmet.	and monitor no	oise generate	d by the aircra	aft, compare the	CEP
	Significant Better	tly Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse
41.		o reducing noise level sonal helmet.	s at your ears	during weap	ons firing, cor	mpare the CEP	
	Significant Better	ily Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse
Gen	eral Issues:			·			
42.	Were there any If Yes, ple	adverse effects of CE	EP performance	ce?Yes	No		
13.]	Please elaborate	on any problems you	u may have en	countered w	hile wearing t	he CEP.	

44.	General comments	about your exp	erience with	me CEP.			
45.]	Based on your flyi		ate the overal	ll value of the	CEP when co	mpared to your	
	personar nerme	·· ·:_		•	•	::_	
*	Significantly Better	Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse